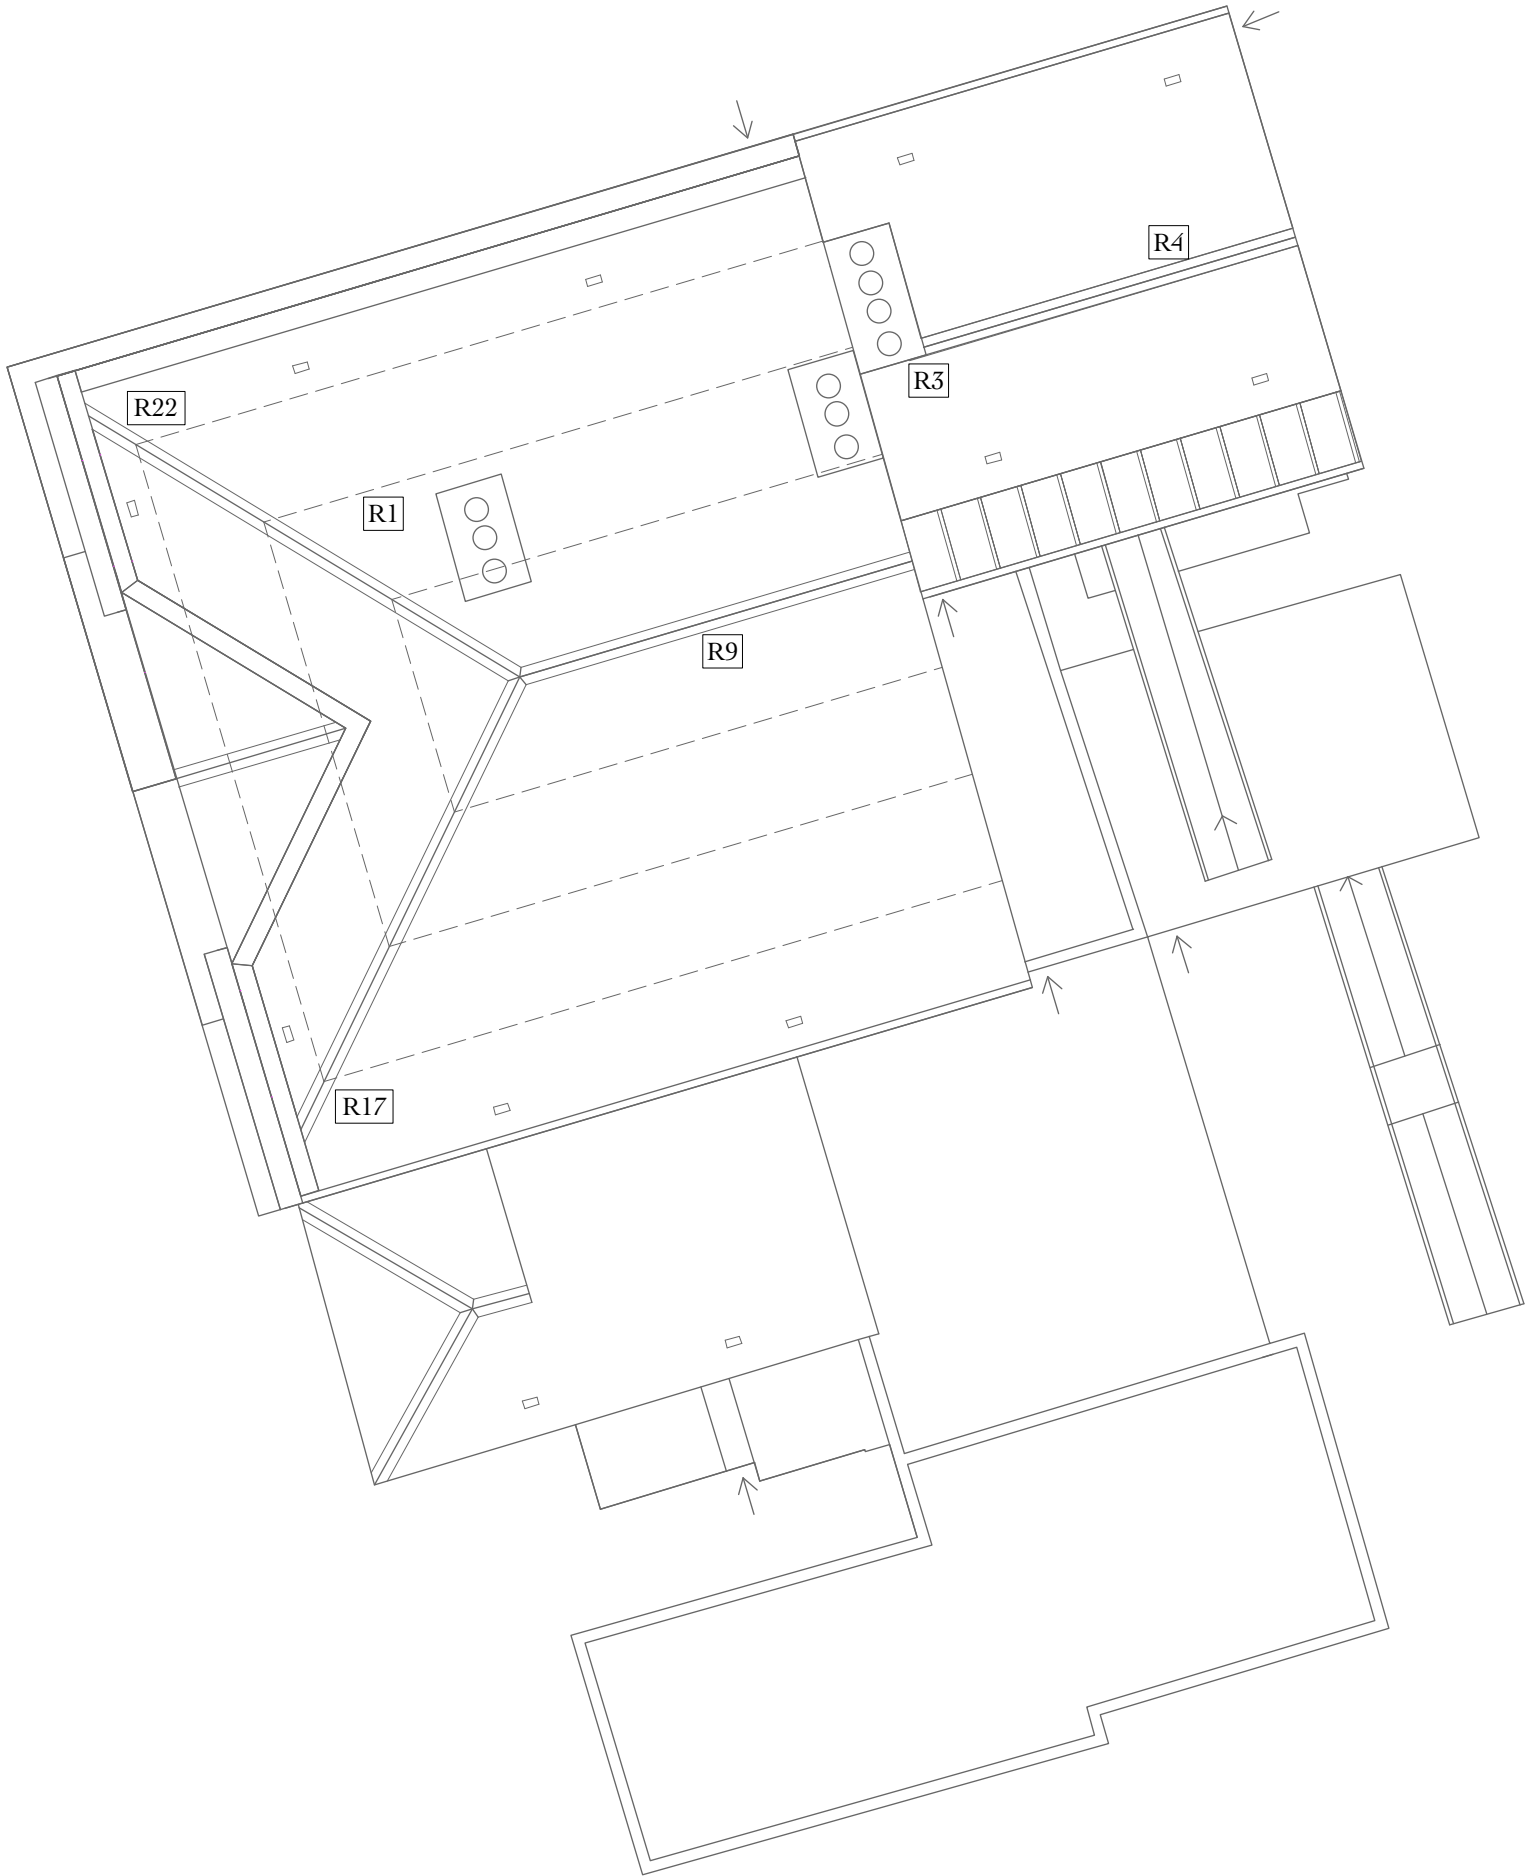


GENERAL NOTES

1. Do not scale from this drawing. Use figured dimensions only. Unless otherwise stated all drawing units are in millimetres. Levels are in meters.
2. This drawing to be read in conjunction with all other relevant consultant/specialist drawings and specifications.
3. Check levels/dimensions quoted on drawing against those on site before finalising.
4. Report any discrepancies before affected work commences.
5. For setting out dimensions, see Architect's drawings.
6. This drawing remains copyright of Blackett-Ord Conservation Ltd. Copy/distribute only with consent of the Author.

KEY

- R1 REFERENCE TO STRUCTURAL DEFECT
- - - - PURLIN

STRUCTURAL DEFECTS:

Ref.	STRUCTURAL DEFECT
R	ROOF
R1	Common rafter slipped off notch in purlin
R3	Daylight between roof & wall
R4	Ridgeboard
R9	Bending failure of ridge beam
R17	Purlins slipping off the hip member
R22	Purlins slipping off the hip member

GENERAL DEFECTS:

1. EXISTING ROOF FELT IS NOT BREATHABLE.
2. SPACING OF EXISTING RAFTERS IS TOO LARGE.



33 Chapel Street, Appleby, Cumbria CA16 6QR - Telephone: 017683 52572
Email: engineering@blackett-ordconservation.co.uk

Cockpit House, Prescott
for Purcell

Roof Plan

Drawing No: X54/104 Rev: - Scale: 1:100 @ A3 Date: October 2021