

BS 5837:2012

Arboricultural Impact Assessment

22nd March 2024

Report No. LTM1097.AIA.01
Project: St Agnes Parish Club
Authored by: Matthew Lally



ARBORICULTURAL IMPACT ASSESSMENT

PROJECT

St Agnes Parish Club

Huyton Hey Road

Huyton

L36 5SQ

LALLY TREE MANAGEMENT

36 Goldsworthy Road,
Urmston,
Manchester,
M41 8US

[T] 07305 740120

[E] matt@lallytreemanagement.co.uk

[W] <https://www.lallytreemanagement.co.uk/>

DOCUMENT ISSUE RECORD

Date of Inspection	Surveyor	Report Version	Issue Date	Author
21.03.2024	Matthew Lally. FdSc MArborA	01	22.03.2024	Matthew Lally. FdSc MArborA

This report is the property of Lally Tree Management. This report may only be reproduced or disclosed to third parties with express written consent from Lally Tree Management.

All comments, conclusions and recommendations within this report are based on the information available to Lally Tree Management at the time of investigation. Lally Tree Management accepts no liability in cases where provided information is found to be inaccurate or misleading or if additional information exists or becomes available.

CONTENTS

EXECUTIVE SUMMARY	1
1. INTRODUCTION	2
1.1. Author Information	2
1.2. Scope and Purpose of the Reports	2
1.3. Instructions & Brief	3
2. SITE VISIT & SURVEY METHODOLOGY	4
2.1. Survey Details	4
2.2. Creation of Existing Site Plans	5
3. PLANNING POLICY	7
3.1. National Planning Policy Framework (NPPF)	7
4. LEGISLATION.....	8
4.1. Statutory Considerations	8
4.2. Felling Licence	9
4.3. Protected Species.....	9
5. THE SITE, ITS SURROUNDINGS & THE TREE POPULATION	11
5.1. Site & Surroundings.....	11
5.2. Tree Population	11
6. ARBORICULTURAL IMPACT ASSESSMENT	12
6.1. Proposed Development.....	12
6.2. Impacts	12
7. MITIGATION PROPOSALS.....	14
7.1. Access Facilitation Pruning	14
7.2. Demolition adjacent to Trees & RPAs	14
8. CAVEATS AND LIMITATIONS.....	16

Appendix I Tree Survey Data & Site Notes

Appendix II Glossary of Terms

Appendix III Cascade Chart

Appendix IV Tree Constraints Plan & Arboricultural Implications Plan

Appendix V Pictorial Evidence

EXECUTIVE SUMMARY

The proposed development site is located within a residential suburb of Huyton in the Metropolitan Borough of Knowsley. The site currently consists of a single-story brick building used as St Agnes Parish Club with a car parking area to the west and south.

Trees present that could be potentially affected by the development are as follows:

Category A	Category B	Category C	Category U
0	7 Trees 1 Group	1 Tree 1 Group	0

It is proposed to demolish the single-storey building used as the Parish Club and convert the area to additional parking. To facilitate this development, trees requiring removal or other works are as follows:

	Tree Category. Trees Requiring Works			
Tree Work Type	Category A	Category B	Category C	Category U
Tree Removal	0	0	0	0
Pruning Works	0	2 Trees	0	0

1. INTRODUCTION

1.1. Author Information

1.1.1. My name is Matthew Lally and I have been working with trees for over 18 years. I have experience in both practical elements of arboriculture and in consulting. I so far hold the following Arboricultural qualifications and technical memberships:

- FdSc Arboriculture
- LANTRA Professional Tree Inspection Certificate
- VALID – Validator
- QTRA Registered User
- Professional Member of the Consulting Arborist Society
- Professional member of the Arboricultural Association
- Associate Member of the Institute of Chartered Foresters.

1.1.2. I am the author of this report and as a Professional Member of the Arboricultural Association, the Consulting Arborist Society and an Associate Member of the Institute of Chartered Foresters, I am required to uphold ethical standards laid out by these institutions and therefore I have written this report in good faith and as objectively as possible.

1.2. Scope and Purpose of the Reports

1.2.1. An Arboricultural Impact Assessment is used to detail reasonably foreseeable conflicts that a development may have with regards to trees on a given site and is intended to assist the Local Planning Authority (LPA), in this case Knowsley Metropolitan Borough Council, in their assessment of the proposed development. I therefore recommend that this report along with the associated Method Statement is supplied to LPA in support of the planning application to which it pertains.

1.2.2. I have aspired in this report to provide an analysis of the impacts that the proposed development is projected to have on trees located within the site based on the information that I have available to me at the time of writing. Where practicable I have included trees on land immediately adjacent to the site that may also be impacted. I also offer guidance on suitable retained tree management and mitigation recommendations for losses or other foreseen issues.

1.3. Instructions & Brief

- 1.3.1. I was commissioned to write this Arboricultural Impact Assessment by Property Surv Building Surveying and Design Ltd on the 14/03/2024 by email. I have prepared this Arboricultural Impact Assessment in relation to the proposed development at St Agnes Parish Club, Huyton Hey Rd, Huyton, Liverpool, L36 5SQ.
- 1.3.2. I attach below an outline overhead photograph of the area that I assessed on the 21/03/2024. (This is not necessarily the site boundary but includes trees that I deem could be impacted by the development regardless of ownership)



Figure 1. Assessment boundary plan.

2. SITE VISIT & SURVEY METHODOLOGY

2.1. Survey Details

- 2.1.1. I visited the site and surveyed the trees in accordance with Chapter 4 of BS5837:2012. I have recorded all the recommended tree metrics in the tree schedule which can be found in appendix I.
- 2.1.2. British Standard 5837:2012 'Trees in Relation to Design, Demolition and Construction - Recommendations' includes guidance for considering the relationship between existing trees and how to integrate their needs into a successful development. A harmonious and sustainable relationship between any retained trees and new structure and/or hard surfaces is at the heart of the guidance.
- 2.1.3. When recording the trees as individual trees, groups of trees, woodlands or hedge groups I have included a prefix on the tree number. Explained as follows: Individual trees (T), groups of trees (G), hedgerows (H) or woodland groups (W).
- 2.1.4. I have used the term 'group' where trees form cohesive arboricultural features either aerodynamically, visually or culturally.
- 2.1.5. I have used the term 'hedgerow' for lines of trees or shrubs less than 5m wide at the base and which are managed or have been managed under an obvious regular pruning regime.
- 2.1.6. I have used the term 'woodland' where there are at least 10 trees and the individual tree canopies generally overlap and interlink, often forming a more or less continuous canopy and trees are the dominant plant form in this area.
- 2.1.7. I carried out the survey on Thursday 21st March 2024 by means of inspection from ground level. If the inspection was restricted for any reason such as lack of access or dense climbing plants etc, then I have noted this in the site notes in appendix I. I have included pictures of the significant trees in appendix V.
- 2.1.8. The weather conditions during the survey were dry and still meaning that the tree inspection was not affected by the weather conditions.

- 2.1.9. In some cases, I may decide to group trees that share very similar characteristics. This method is in line with point 4.2.4 of BS 5837:2012 and I quote 'Trees forming groups should be identified and considered as groups where the arboriculturist determines that this is appropriate. It may be appropriate to assess the quality and value of trees as a whole, rather than individuals.'
- 2.1.10. I assessed all the trees using: a grading A to C (A being of high quality and C being of the lowest quality) and U (trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years). I attach in appendix III the British Standard 5837:2012 cascade chart for further details.
- 2.1.11. I have where appropriate recorded the canopy spread for each tree at four cardinal points in order to reproduce an accurate representation of the crown shape of the tree, this was generally not possible for tree groups, woodlands and hedges and therefore these were averaged and are represented by simplified representations on the plans. These representations can be seen in the plans that I have attached in appendix IV.

2.2. Creation of Existing Site Plans

- 2.2.1. I have shown the Root Protection Area (RPA) on the plans in appendix IV for each tree as a circle centred on the base of the stem which is based on the recommendation of the British Standard. Due to the presence of roads, structures, topography (and past tree management) the RPA is likely to be a simplified representation of the tree roots actual morphology and disposition. However, I have avoided any detailed modifications to the shape of the RPA as this would largely be based on conjecture.
- 2.2.2. British Standard 5837:2012 recommends the assessment of trees is made as objectively as possible, but I note that although I do my utmost to be as objective as possible, the findings and recommendations in this report will always be my opinion. The tree categorisation method identified in the British Standard is a tool I use on every Arboricultural impact Assessment as this guidance helps to make an objective judgment of the tree quality and value of the existing tree stock and keep the judgment as consistent and fair as possible.
- 2.2.3. Table 1 provides a summary of the documents that have been made available by the client to myself for use in this report:

Table 1 Documents made available by client.

Document Type	Reference No.	Author	Date
Topographical Survey	1101/0124/2	BPD Site Services	Jan 2024
Proposal	-	Property Surv Building Surveying and Design Ltd	2024

- 2.2.4. I note that the supplied existing site plans did include tree locations and these have been assumed to be accurate.
I do not accept any liability for inaccurately plotted trees.
- 2.2.5. Assessing the potential influence of trees upon load bearing soils and the potential impact to existing and proposed structures was not included in the contract brief and I have therefore not considered this in the report. I cannot be held responsible for damage arising from such action.
- 2.2.6. During the site visits I have inspected the trees in line with the British Standard recommendations for potentially hazardous trees and I have made appropriate recommendations where required. I note, however, that this report is not a substitute for a full tree risk assessment or management plan which are specifically designed to minimise risk and liability associated with responsibility for trees.

3. PLANNING POLICY

3.1. National Planning Policy Framework (NPPF)

3.1.1. It is my understanding that when determining planning applications, Local Planning Authority's (LPA) should apply the following principles:

- If significant harm to biodiversity resulting from a development cannot be avoided (through locating on an alternate site with less harmful impacts), adequately mitigated, or, as a last resort, compensated for, then planning permission should be refused.
- Development resulting in the loss or deterioration of irreplaceable habitats (such as ancient woodland and ancient or veteran trees) should be refused unless there are wholly exceptional reasons, and a suitable compensation strategy exists.
- Development whose primary objective is to conserve or enhance biodiversity should be supported; while opportunities to incorporate biodiversity improvements in and around developments should be encouraged, especially where this can secure measurable net gains for biodiversity. (paragraph 186)

3.1.2. Consideration should also be taken of paragraph 136 of the NPPF which states:

Trees make an important contribution to the character and quality of urban environments and can also help mitigate and adapt to climate change. Planning policies and decisions should ensure that new streets are tree-lined⁵⁰, that opportunities are taken to incorporate trees elsewhere in developments (such as parks and community orchards), that appropriate measures are in place to secure the long-term maintenance of newly planted trees, and that existing trees are retained wherever possible. Applicants and local planning authorities should work with highways officers and tree officers to ensure that the right trees are planted in the right places, and solutions are found that are compatible with highways standards and the needs of different users. (Paragraph 136)

4. LEGISLATION

4.1. Statutory Considerations

4.1.1. The Town and Country Planning Act (1990) (the Act) and associated Regulations empower Local Planning Authorities (LPAs) to protect trees in the interests of amenity by making Tree Preservation Orders (TPOs). The Act also affords protection for trees with a diameter at breast height over 75 mm diameter that stand within the curtilage of a Conservation Area. An application must be made to the LPA in question to carry out works upon or to remove trees that are subject to a TPO, whilst six weeks' notice of intention must be given to carry out works upon or to remove trees within a Conservation Area that are not protected by a TPO.

4.1.2. A Tree Preservation Order (TPO) is an order made by a local planning authority to protect specific trees, groups of trees or woodlands in the interests of amenity. A TPO prohibits the:

- cutting down
- topping
- lopping
- uprooting
- willful damage
- willful destruction

of trees without the LPA's written consent. If consent is given, it can be subject to conditions which have to be followed. In the Secretary of State's view, cutting roots is also a prohibited activity and requires the authority's consent. Anyone found guilty of such an offence is liable and in serious cases, may result in prosecution and incur an unlimited fine.

4.1.3. I have not directly contacted the Local Planning Authority, however, I have used the online search facility on the website for the Local Planning Authority, Knowsley Metropolitan Borough Council. I have confirmed through this online service that there are no Tree Preservation Orders and Conservation Areas that would apply to any trees present on, or in close proximity to the assessment site and therefore no statutory constraints would apply to the development in respect of trees. I recommend that before any tree works are undertaken confirmation of the online information should be sought from the Local Authority.

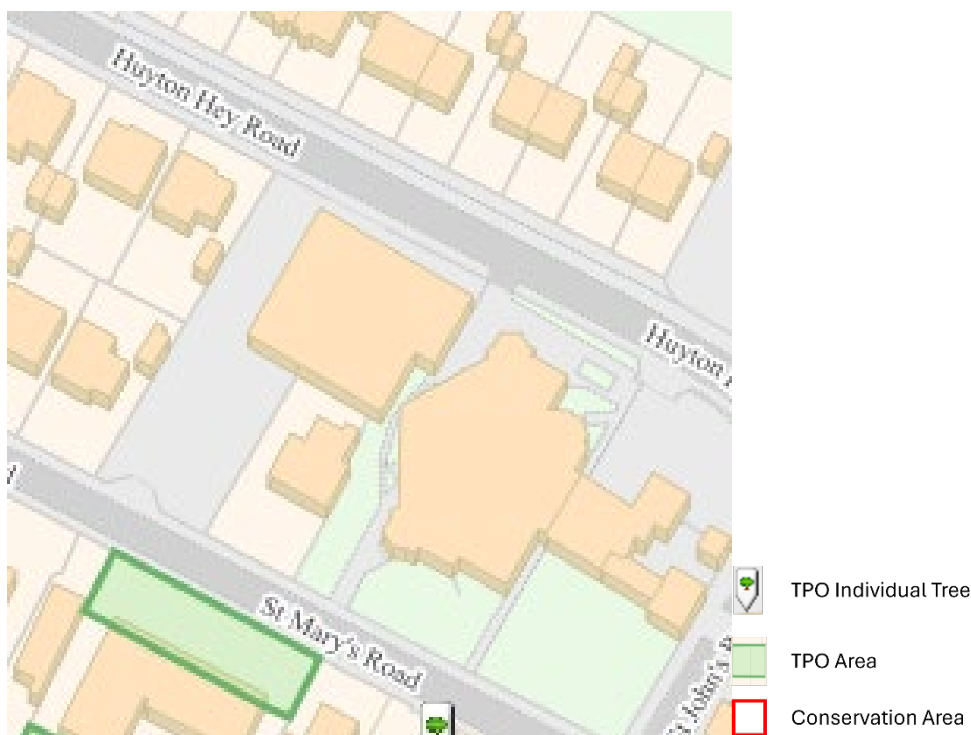


Figure 2. A screenshot of the Knowsley Metropolitan Borough Council interactive map showing the location of any TPO's or Conservation Areas in relation to the site. (Accessed 22.03.2024, <https://secured.knowsley.gov.uk/myneighbourhood#>)

4.2. Felling Licence

- 4.2.1. Tree felling is also restricted under the Forestry Act 1967. Felling licences are Under this act, there is an exemption from the need for a felling licence for “Felling trees immediately required for the purpose of carrying out development authorised by planning permission (granted under the Town and Country Planning Act 1990) ...”
- 4.2.2. If full planning permission is granted, then any trees which require felling to implement the approved plans are exempt from this statutory protection. Outline planning permission does not provide an exemption to the regulations that control tree felling in the Forestry Act 1967.

4.3. Protected Species

- 4.3.1. Nesting birds are afforded statutory protection under the Wildlife & Countryside Act (1981) (as amended) and their potential presence should therefore be considered when clipping hedges, removing climbing plants and pruning and removing trees. The breeding period for woodlands runs from March to August inclusive. Hedges provide valuable nesting sites for many birds and clipping should therefore be avoided during March to July. Trees, hedges and ivy should be inspected for nests prior to pruning or

removal and any work likely to destroy or disturb active nests should be avoided until the young have fledged.

- 4.3.2. All bat species and their roosts are protected under Schedule 5 of the Wildlife & Countryside Act (1981) (as amended) and under Schedule 2 of the Conservation of Habitats & Species Regulations 2010 (as amended). In this respect it should be noted that it is possible that unidentified bat habitat features may be located high up in tree crowns and all personnel carrying out tree works at the site should therefore be vigilant and mindful of the possibility that roosting bats may be present in trees with such features. If any bat roosts are subsequently identified, then it is essential that works are halted immediately and that a suitably qualified and experienced ecologist investigates and advises on appropriate action prior to works continuing.
- 4.3.3. In turn, any subsequent works carried out in relation to any protected species must be carried out under guidance from a suitably qualified and experienced ecologist and in strict accordance with the guidance provided in BS42020:2013 - Biodiversity – Code of Practice for Planning and Development and, with regard to bats, in strict accordance with BS8596:2015 - Surveying for Bats in Trees and Woodlands.

5. THE SITE, ITS SURROUNDINGS & THE TREE POPULATION

5.1. Site & Surroundings

- 5.1.1. The site under consideration is located within a residential suburb of Huyton in the Metropolitan Borough of Knowsley. The site currently consists of a single-story brick building used as St Agnes Parish Club with a car parking area to the west and south.
- 5.1.2. It is bordered to the north by Huyton Hey Road and to the south by St Mary's Road. St Agnes R C Church borders the east of the site and residential properties lie to the west.

5.2. Tree Population

- 5.2.1. As noted previously, a total of eight individual trees and two groups of trees were surveyed for the purpose of this appraisal. They range from young to mature in age, with heights up to approximately 16 metres, maximum diametrical crown spreads up to approximately 11 metres, and stem diameters up to approximately 700 millimetres. Detailed tree dimensions and other pertinent information, such as structural defects and physiological deficiencies, are included in the Tree Schedule in Appendix I.
- 5.2.2. Under the UK's planning system trees are a material consideration in the planning and development process. Nonetheless, only trees of a suitable quality and value should be considered a material constraint to development. In this respect the Tree Schedule includes a column ('Cat. Grade') listing the trees' respective retention values, where they are rated either 'A', 'B', 'C' or 'U', as per BS5837:2012 Table 1 (appendix III). 'A' category trees are those considered to be of 'high quality' and, accordingly, the most suitable for retention, whilst 'B' category trees are those considered to be of 'moderate quality', and 'C' category trees are those considered to be of 'low quality' with a correlated low retention value. In turn, 'U' category trees are those that are considered to be 'unsuitable for retention'.
- 5.2.3. As detailed in the Tree Schedule in appendix I, seven trees and one group were categorised as moderate quality (i.e. 'B' category) and one tree and one group were categorised as low quality (i.e. 'C' category).

6. ARBORICULTURAL IMPACT ASSESSMENT

6.1. Proposed Development

- 6.1.1. It is proposed to demolish the single-storey building used as the Parish Club and convert the area to additional car parking. These proposals are encapsulated in the proposed site plan provided by Property Surv Building Surveying and Design Ltd.

6.2. Impacts

- 6.2.1. I have overlayed the proposed site plan provided by Property Surv Building Surveying and Design Ltd onto the existing site plan using computer aided design software and found locations in which there are conflicts with existing trees. I have made this plan available in appendix IV titled Arboricultural Implications plan.
- 6.2.2. In order to fully assess the impact of the proposals, I have created an Impact Table below (Table 2) in which I detail each tree, showing the proximity of the associated works to the trees and if they can or cannot be retained.
- 6.2.3. I used the aforementioned Impact Table and Arboricultural Implications Plan in my analysis to determine whether the development will have an impact on the health of each tree. Where I have determined there is an impact, I have then decided upon any mitigation measures that could be implemented to reduce the impact the proposals will have on the treescape.

Table 2. Impact Table

Tree No.	Root Protection Area identified (m ²) in Table 2 of BS 5837:2012	Distance to Proposed Hard Standing (m)	Distance to Proposed Development (m)	Can the Tree/s be Successfully Retained	Retention Category
G1	88	5.80	7.10	Yes	B2
T2	92	25.90	25.90	Yes	B1
T3	127	12.60	12.60	Yes	B1
T4	222	2.80	2.80	Yes, as outlined in section 7.1 & 7.3	B1
T5	163	3.60	3.60	Yes, as outlined in	B1

Tree No.	Root Protection Area identified (m ²) in Table 2 of BS 5837:2012	Distance to Proposed Hard Standing (m)	Distance to Proposed Development (m)	Can the Tree/s be Successfully Retained	Retention Category
				section 7.1 & 7.3	
G6	7	19.20	19.20	Yes	C1
T7	191	23.60	23.60	Yes	B1
T8	222	28.50	28.50	Yes	B1
T9	157	28.50	28.50	Yes	B1
T10	28	28.20	26.70	Yes	C1

6.2.4. I have created an Assessment Table (Table 3) to help visualise the number of trees that will or will not be impacted by the proposed development. To assess the implications of the Impact Table each tree can be categorised in the following way: -

Table 3. Assessment Table

	Trees to be Retained		Trees to be Removed	
	With No Impact	With detailed construction	Due to Condition	Due to Development
Category A	-	-	-	-
Category B	G1, T2, T3, T7, T8, T9	T4, T5	-	-
Category C	G6, T10	-	-	-
Category U	-	-	-	-
TOTAL	8	2	0	0

6.2.5. As can be seen in table 3, no trees require removal to facilitate this development.

7. MITIGATION PROPOSALS

7.1. Access Facilitation Pruning

- 7.1.1. I note that the branches of T4 & T5 are in direct contact with the building that is to be demolished. The branches will require pruning to facilitate the demolition. I recommend that the crown of T4 & T5 is raised on the building side of the crown to a height of 4.5m to facilitate the demolition.
- 7.1.2. It is my opinion that if all pruning works are undertaken in line with British Standard 3998:2010 Tree Work – Recommendations then the Safe Useful Life Expectancy of the trees will not be adversely affected.

7.2. Demolition adjacent to Trees & RPAs


- 7.2.1. It is possible the demolition of the existing building could negatively impact the retained trees at this site.
- 7.2.2. It is my opinion that any negative impacts can be mitigated if during demolition, the following restrictions will apply:
- Where direct damage by falling masonry is likely, the tree should be protected by exterior grade plywood sheets constructed around the main stem.
 - The main body of any mechanical excavator will operate outside the RPA.
 - Masonry will be pulled away from trees.
 - When breaking masonry, a fine water spray will be used to minimise dust particles if it is likely to cover leaves.
 - Excessive dust particles on trees will be removed each day by spraying with water.
 - Hard surfaces should be kept in place for as long as possible during construction works in order to prevent soil compaction in the RPA.

7.3. Excavation into the Existing Foundations and Uplift & Re-laying of Existing Hardstanding

- 7.3.1. During my analyses I noted that the building to be demolished is to be converted into a car park area and therefore there will likely need to be excavated in the RPA of T4 & T5. This excavation will also likely be required in the hardstanding footpath adjacent to the building.
- 7.3.2. I believe that any possible impacts from these excavation works can be avoided if all excavation within the RPA is limited to the existing hardstanding layer/ foundation layer, work is undertaken with the smallest possible machine that can do the job, and excavation work is supervised by an arboricultural consultant.

8. CAVEATS AND LIMITATIONS

- 8.1.1. The report is for the sole use of the client and its reproduction or use by anyone else is forbidden unless written consent is given by myself (Matthew Lally).
- 8.1.2. This is an arboricultural report and as such no reliance should be given to comments relating to buildings, engineering, soils ecological or archaeological data. If either is commented upon within the report further professional advice should be sought.
- 8.1.3. This is not a Tree Risk Assessment. As such this report should not be taken to mean or imply that any of the inspected trees should be considered safe. A Tree Risk Assessment can be provided but would be subject to additional survey requirement and further fees.
- 8.1.4. Trees are growing dynamic structures. Whilst all reasonable effort has been made to identify defects within the trees inspected, no guarantee can be given as to the absolute safety or otherwise of any individual tree. No tree is ever absolutely safe due to the unpredictable laws and forces of nature. As a result of this, natural failure of intact trees will occur; extreme climatic conditions can cause damage to even apparently healthy trees.
- 8.1.5. For the purposes of this survey all dimensions of trees and their associated parts are based on estimation unless otherwise stated.
- 8.1.6. Trees are living organisms whose health, condition and structure can change quickly and without warning. Therefore, the contents of this report are valid for a period of one year from the date of this survey.

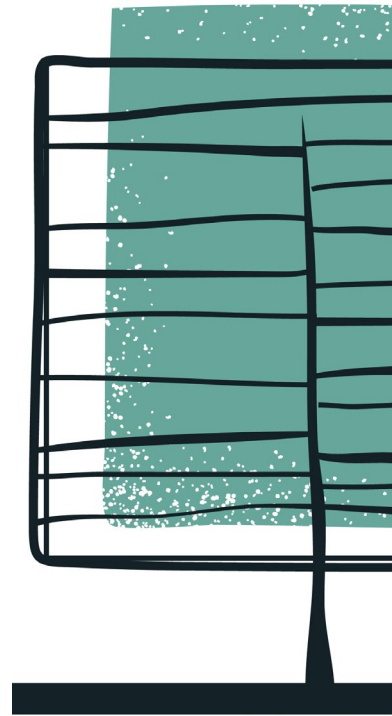

Appendix I

Tree Survey Data & Site Notes

*The recommendations in this section are based on the site survey only and are **NOT** recommendations to facilitate the development plans. See the Arboricultural METHOD STATEMENT for tree works required to facilitate the development.

BS5837:2012 TREE SCHEDULE



DATE OF SURVEY: 21/03/2024

JOB REFERENCE: LTM1097.AIA.01

SITE ADDRESS: St Agnes Parish Club, Huyton Hey Rd, Huyton, L36 5SQ


Tree No.	Species	Stem Dia (mm)	RPA (m ²)	RPA Radius (m)	Height (m)	Age Class	Crown Spread (m)				Crown Clearance (m)	Condition	Comments	Recommendations	Remaining Contribution	BS5837 Retention Category
							N	E	S	W						
G1	Holly x 2	440	88	5.28	10	EM	2.5	2.5	2.5	2.5	2N	A	A group of 2 holly trees located in formal garden area. Multi-stemmed. Vitality appears normal. No significant risk features observed.	No action	40+	B2
T2	Birch	450	92	5.4	14	EM	5.5	5	5	4.5	2.5N	A	Located in formal planting bed adjacent to Huyton Hey Road. Vitality is within normal range. Tree appears stable.	No action	40+	B1
T3	Cypress	530	127	6.36	9	EM	2	2	2	2	2.5N	B	Codominant form with acute primary unions but of little concern. Vitality is within normal range. Tree appears stable. Highly visible from public viewpoints.	No action	20+	B1
T4	Sycamore	700	222	8.4	15	M	5	4.5	4.5	5	4N	A	Good form and vitality. No significant risk features observed. Highly visible from public viewpoints.	No action	40+	B1
T5	Sycamore	600	163	7.2	12	EM	5.5	5.5	5.5	5.5	4S	A	Good form and vitality. No significant risk features observed. Highly visible from public viewpoints.	No action	40+	B1
G6	Holly x 1. Irish Yew x 1	120	7	1.44	4	Y	1.5	1.5	1.5	1.5	0N	A	Good form and vitality. Located in car park area.	No action	40+	C1
T7	Sycamore	650	191	7.8	15	EM	6	6	4	5	3.5E	B	An ivy clad specimen located in planting area in car park. Limited inspection and estimated DBH due to ivy.	No action	40+	B1
T8	Monterey Cypress	700	222	8.4	15	EM	6	3	3	6	2W	A	Asymmetrical crown due to adjacent trees. Low branches over path and car park entrance. Stem growth is damaging wall.	Crown lift to 3m. Monitor wall and repair as required	40+	B1
T9	Sycamore	590	157	7.08	16	EM	4	5	5	4	4N	B	A double stemmed tree with included union at 0.4m. Union appears stable. Vitality is within normal range. Tree is highly visible from public viewpoints.	No action	40+	B1

BS5837:2012

TREE SCHEDULE



DATE OF SURVEY: 21/03/2024			JOB REFERENCE: LTM1097.AIA.01			SITE ADDRESS: St Agnes Parish Club, Huyton Hey Rd, Huyton, L36 5SQ										
Tree No.	Species	Stem Dia (mm)	RPA (m ²)	RPA Radius (m)	Height (m)	Age Class	Crown Spread (m)				Crown Clearance (m)	Condition	Comments	Recommendations	Remaining Contribution	BS5837 Retention Category
							N	E	S	W						
T10	Holly	250	28	3	7	EM	1	2.5	3	1	3S	A	Asymmetrical crown. Double stemmed with acute basal union. Vitality appears normal. Tree appears to be stable. Dead elderberry bush close to this tree should be removed.	Remove dead elderberry bush next to this tree	40+	C1

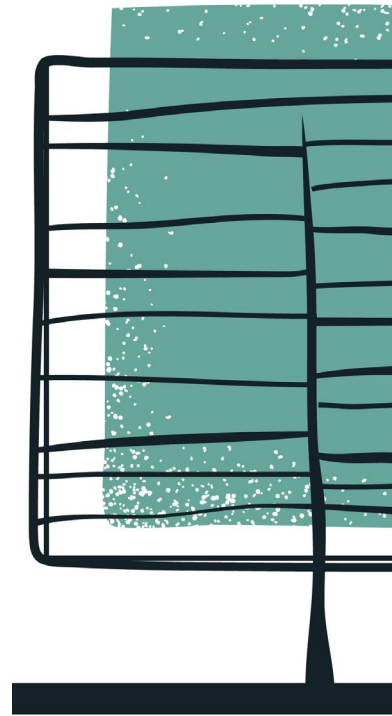

Appendix II

Glossary of Terms

The following terms are concurrent with best Arboricultural practice and within the guidelines set by the International Society of Arboriculture (ISA), the Arboricultural Association (AA) and the British Standards Institute (BSI).

Age Range:

Age is site specific and categorised:

Young (Y)	Out-planted trees that have not yet established.
Semi-Mature (SM)	Established trees up to 1/3 of expected height and crown.
Early Mature (EM)	Between 1/3 and 2/3 of expected height and crown.
Mature (M)	Between 2/3 and full expected height and crown.
Fully Mature (FM)	Full expected height and crown.
Over Mature (OM)	Crown beginning to break-up and decrease in size.
Senescent (S)	Crown in advanced stage of break-up.

Height: Height is estimated and recorded in metres.

DBH: Diameter at Breast Height is measured at 1.5m and recorded in metres. Where a tree becomes multi-stemmed below 1.5m the highest possible diameter is measured and indicated. Alternatively, above 1.5m the diameter of each stem or an average diameter is measured and indicated.

Condition: Assessment of current physiological condition and structural morphology incorporating vigour and vitality and categorised:

- A -** Tree needing little, if any attention
- B -** Tree with minor, but rectifiable defects, or in the early stages of physiological stress
- C -** Tree with significant structural and physiological flaws and/or extremely stressed
- D -** Tree that is dead, biologically/physically moribund or dangerous.

Desirability to Retain – As Outlined in Table 1 of BS 5837:2005 (Trees in Relation to Construction - Recommendations)

Definition of Physiological & Morphological Terms

Adaptive Growth - The process whereby wood formation is influenced both in quantity and in quality by the action of gravitational force and mechanical stresses on the cambial zone.

Bifurcation – Forked or divided union.

Brown Rot - Form of decay where cellulose is degraded, while lignin is only modified.

Cankers- A localised area of dead bark and cambium on a stem or branch, caused by fungal or bacterial organisms, characterised by wound wood development on the periphery. This may be annual or perennial.

Cavity - An open wound, characterised by the presence of extensive decay and resulting in a hollow.

Chlorotic Leaf - Lacking in chlorophyll, typically yellow in colour.

Compartmentalisation - The physiological process that creates the chemical and mechanical boundaries that act to limit the spread of disease and decay organisms.

Crack - Longitudinal split in stem or branch, involving bark and/or underlying wood. These may be vertically and horizontally orientated.

Decay - Process of degradation of woody tissues by fungi and bacteria through decomposition of cellulose and lignin.

Deadwood - Deadwood is often present within the crown or on the stems of trees. In some instances, it may be an indication of ill health, however, it may also indicate natural growth processes. If a target is present beneath the tree, deadwood may fall and cause injury or damage and should be removed, otherwise deadwood can remain intact for conservation purposes (insects, fungi, birds etc.).

End Weight - The concentration of foliage at the distal ends of stems and deficient in secondary branches.


Girdling Root - Root which circles and constricts the stem or roots causing death of phloem and/or cambial tissue.

Hazard Beam - An upwardly curved branch in which strong internal stresses may occur without the compensatory formation of extra wood (longitudinal splitting may occur in some cases).

- Included Bark Union** - Pattern of development at branch junctions where bark is turned inward rather than pushed out. Potential weakness due to a lack of a woody union.
- Ivy Growth** - Ivy growth may ascend into the tree's crown, increasing wind resistance, concealing potential defects and reducing the tree's photosynthetic capacity. Ivy growth is often acceptable in woodland areas as a conservation benefit.
- Live Crown Ratio** - The relative proportion of photosynthetic mass (leaf area) to overall tree height.
- Reaction Wood** - Specialised secondary xylem, which develops in response to a lean or similar mechanical stress, attempting to restore the stem to the vertical.
- Root Plate Lift** - The physical movement of the rooting plate causing soils to shift and crack. May occur during adverse weather conditions. Trees may become unstable.
- Root Protection Area** - Layout design tool indicating the minimum area around a tree deemed to contain sufficient roots and rooting volume to maintain the tree's viability, and where the protection of the roots and soil structure is treated as a priority. This area should be considered a no go area for development unless very careful mitigation measures are implemented and agreed with the LPA.
- Structural Defect** - Internal or external points of weakness, which reduce the stability of the tree.
- Suppressed** - Trees which are dominated by surrounding vegetation and whose crown development is restricted from above.
- Topping** - A highly disfiguring practice, likely to cause severe xylem dysfunction and decay in major structural parts of the wood.
- White Rot** - Form of decay where both cellulose and lignin are degraded.
- Wound** - Any injury, which induces a compartmentalisation response.
- Wound wood** - Wood with atypical anatomical features, formed in the vicinity of a wound and a term to describe the occluding tissues around a wound as opposed to the ambiguous term "callus."
- Woodland Structure** - The vertical and horizontal arrangement of trees within a group or woodland i.e. Dominant - trees with a crown above the upper layer of the canopy, Co-dominant - trees that define the general upper edge of the canopy, Intermediate - trees that have been largely overgrown by others, Suppressed - trees that have been

overgrown and occupy an understory position and grow slowly, often severely asymmetrical.


Note: The definitions described above, may not necessarily be included within the Arboricultural Survey Data.

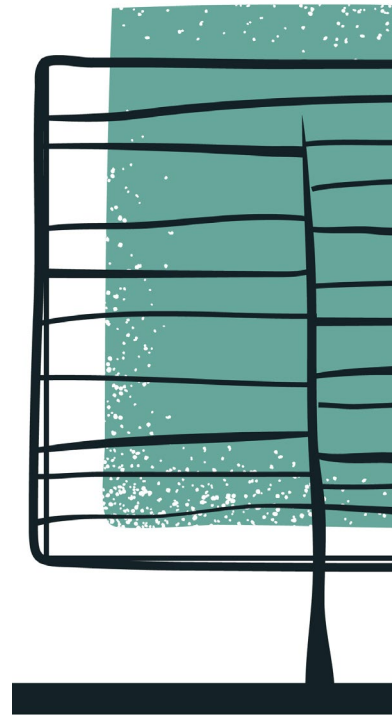

Appendix III

Cascade Chart

Trees for removal			
Category and definition	Criteria		
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	○ Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other U Category trees (i.e. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) ○ Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline. ○ Trees infected with pathogens of significance to the health and/or safety of other trees nearby) e.g. Dutch elm disease), or very low-quality trees suppressing adjacent trees of better quality. NOTE: <i>Category U trees can have existing or potential conservation value which might be desirable to preserve; see section 4.7.5</i>		
Trees to be considered for retention			
Category and definition	Criteria and sub-categories		
	1) Mainly arboricultural values	2) Mainly landscape values	3) Mainly cultural values (including conservation)
Category A Trees of high quality: with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species especially if rare or unusual, or essential components of groups, or of formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and or landscape features	Trees, groups or woodlands of significant conservation, historical commemorative or other value (e.g. veteran trees or wood-pastures)
Category B Those of moderate quality: with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider area	Trees with clearly identifiable conservation or other cultural benefits
Category C Those of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in the higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater landscape value, and/or trees offering low or only temporary screening benefit.	Trees with no material conservation or other cultural value

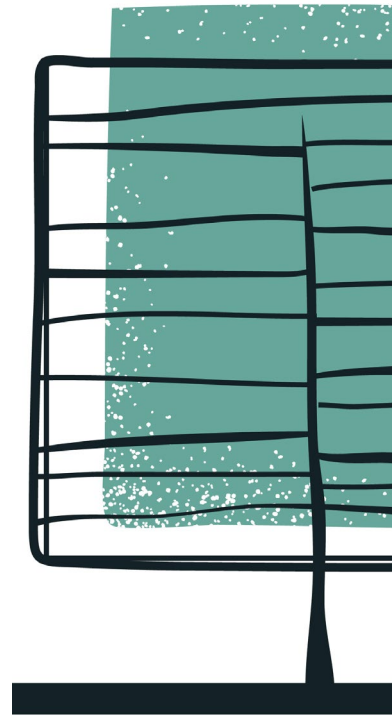


Appendix IV


Tree Constraints Plan &
Arboricultural Implications
Plan

Do not scale this drawing (printed or electronic version).
Contractors must check all dimensions from site
This drawing is for use on this site only and should be used in conjunction with all relevant consultants drawings..

LEGEND




- Category A
- Category B
- Category C
- Category U
- Root Protection Area (RPA)
- Position estimated on site

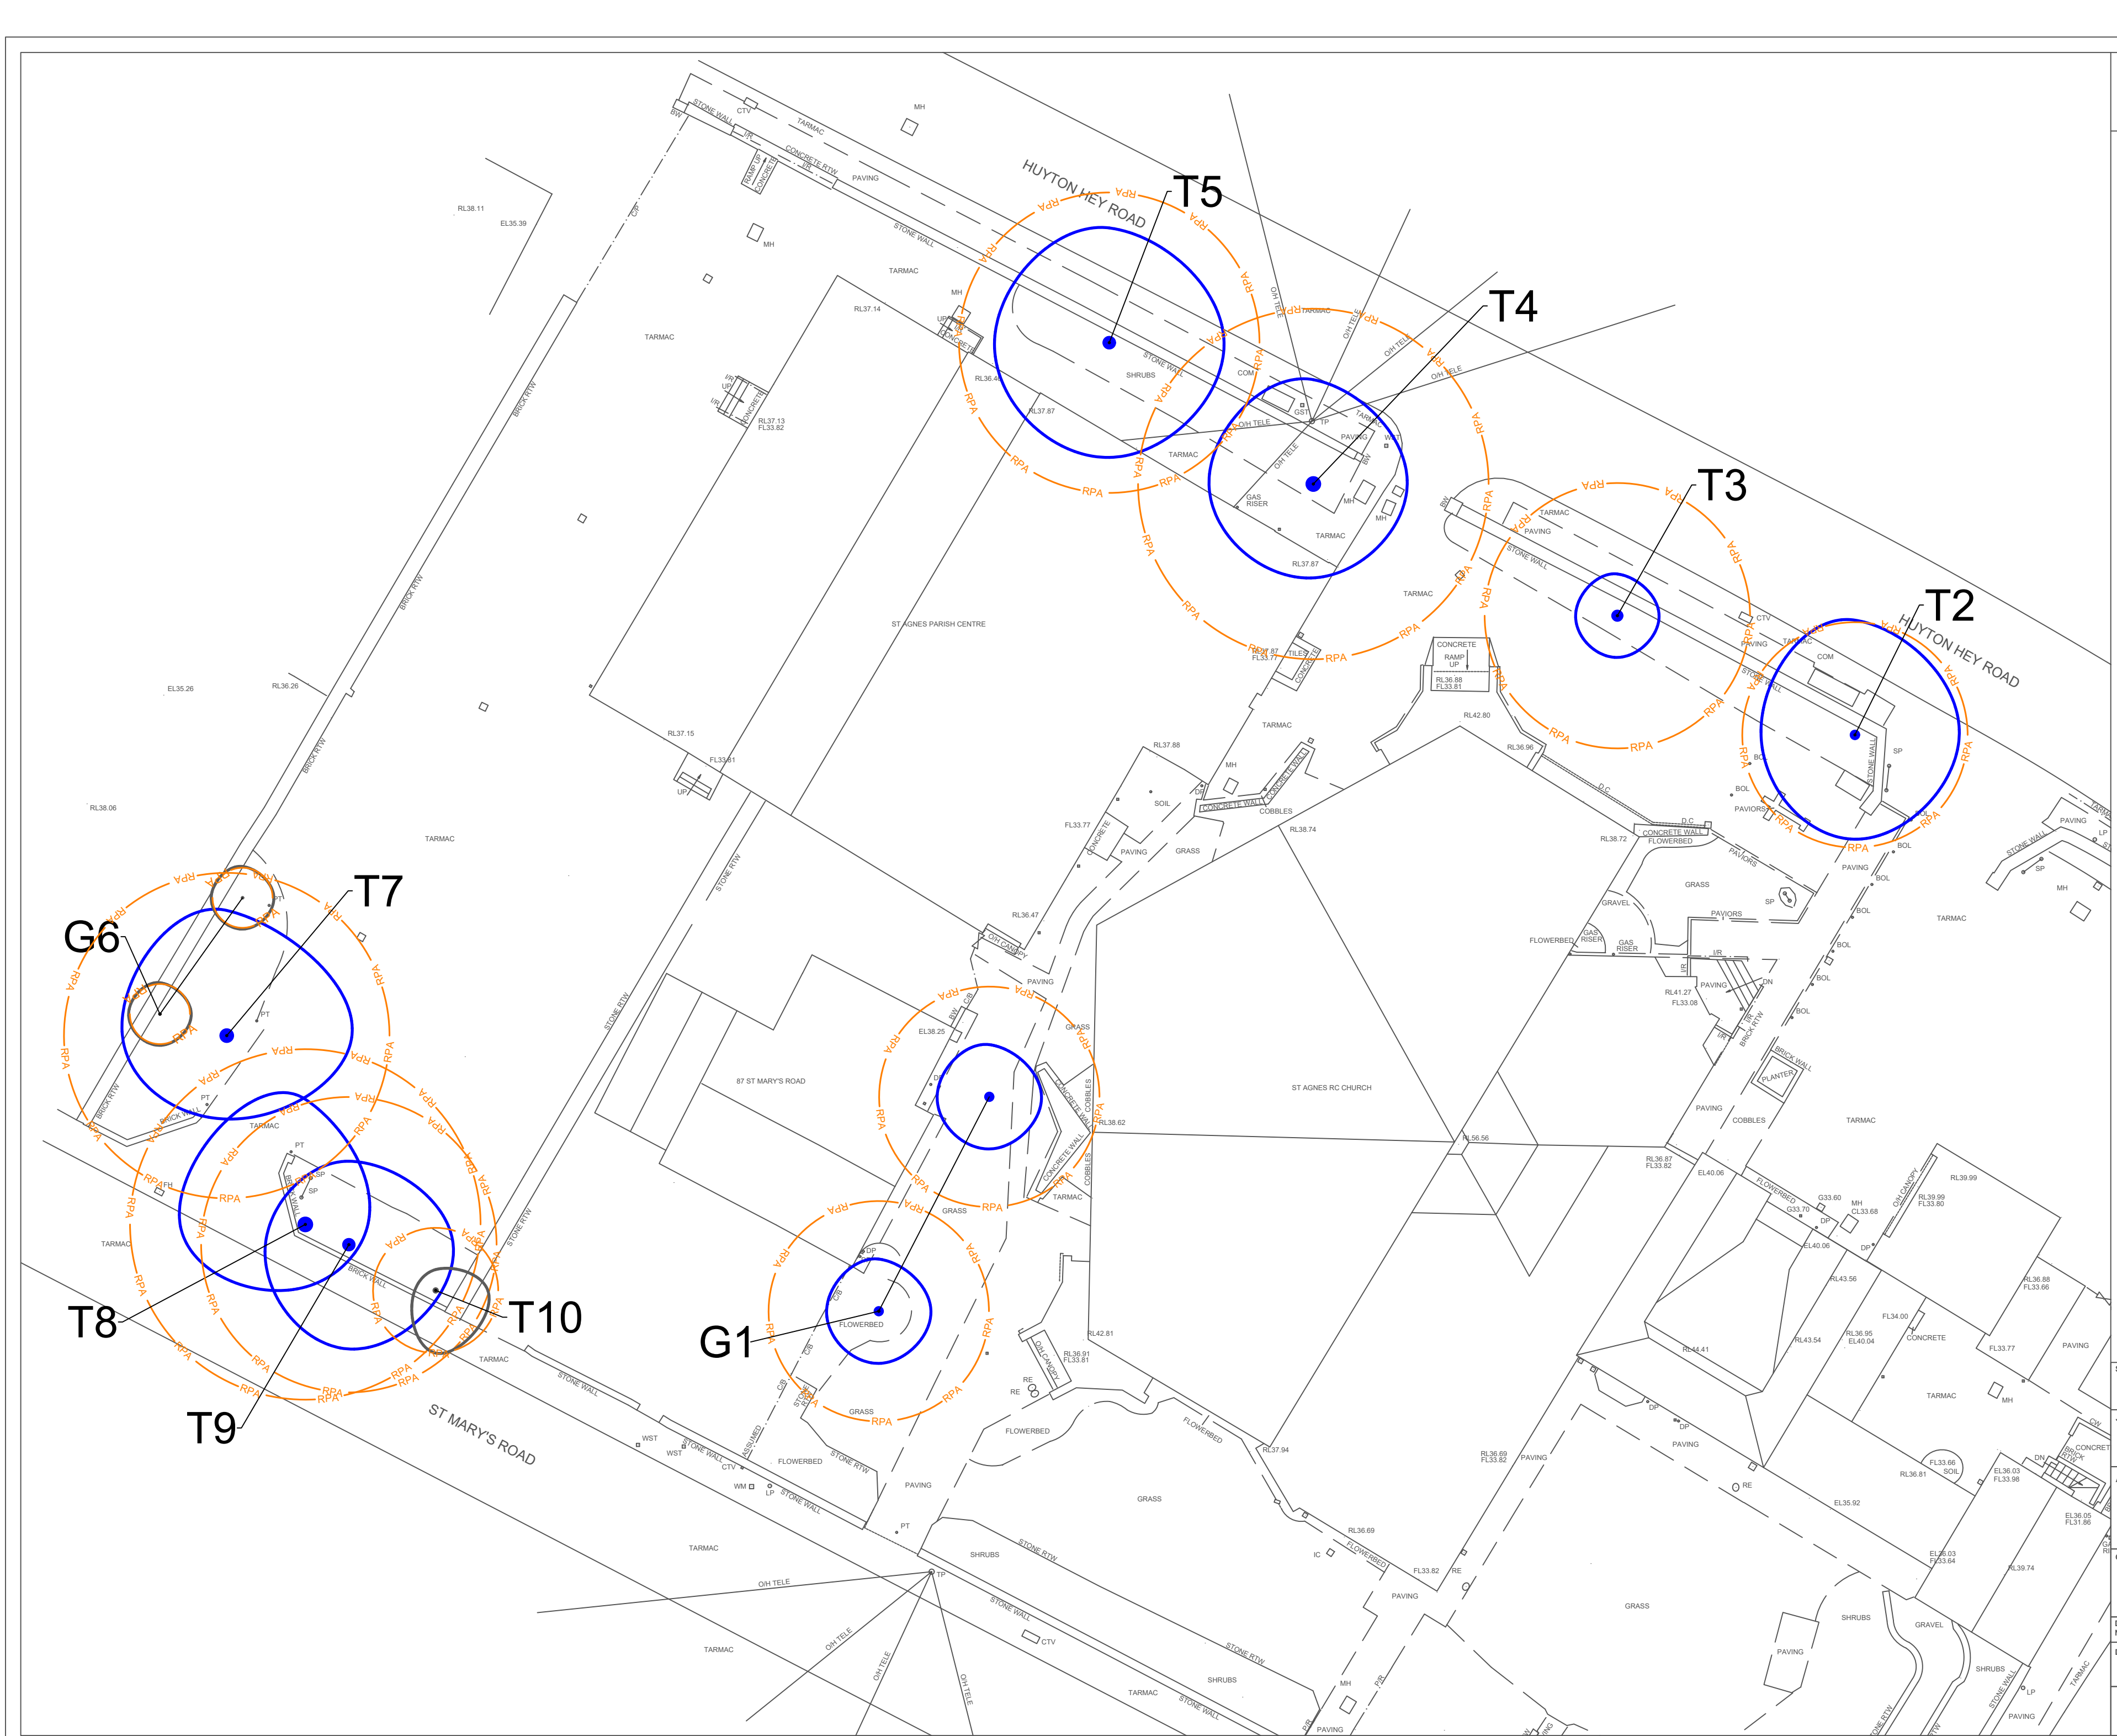

Scale: 1:200 @ A2	Date: 23/03/2024
Job: LTM1097.AIA.01	
Address: St Agnes Parish Club, Huyton Hey Rd, Huyton, L36 5SQ.	
Client: Property Surv Building Surveying and Design Ltd	
Drawing Number: LTM1097.TCP.01	
Drawn by: Matthew Lally	
TREE CONSTRAINTS PLAN	

Do not scale this drawing (printed or electronic version).
Contractors must check all dimensions from site
This drawing is for use on this site only and should be used in conjunction
with all relevant consultants drawings..

LEGEND



- Category A
- Category B
- Category C
- Category U
- Root Protection Area (RPA)
- Position estimated on site
- Building to be Demolished

PARTY GARDEN WALL TO BE CAREFULLY
DECONSTRUCTED. ALLOW FOR SCREENING
OFF WALL WITHIN THE ADJOINING REAR
GARDEN TO BE IN IN ACCORDANCE WITH THE
SPECIFICATION AND ASSOCIATED DRAWINGS.
PRIOR TO THE WORKS COMMENCING THIS IS
TO BE AGREED WITH THE PROPERTY OWNER.



Scale: 1:200 @ A2 Date: 23/03/2024

Job: LTM1097.AIA.01


Address: St Agnes Parish Club, Huyton Hey Rd, Huyton, L36 5SQ.


Client: Property Surv Building Surveying and Design Ltd

Drawing Number: LTM1097.AIP.01

Drawn by: Matthew Lally

ARBORICULTURAL
IMPLICATIONS PLAN

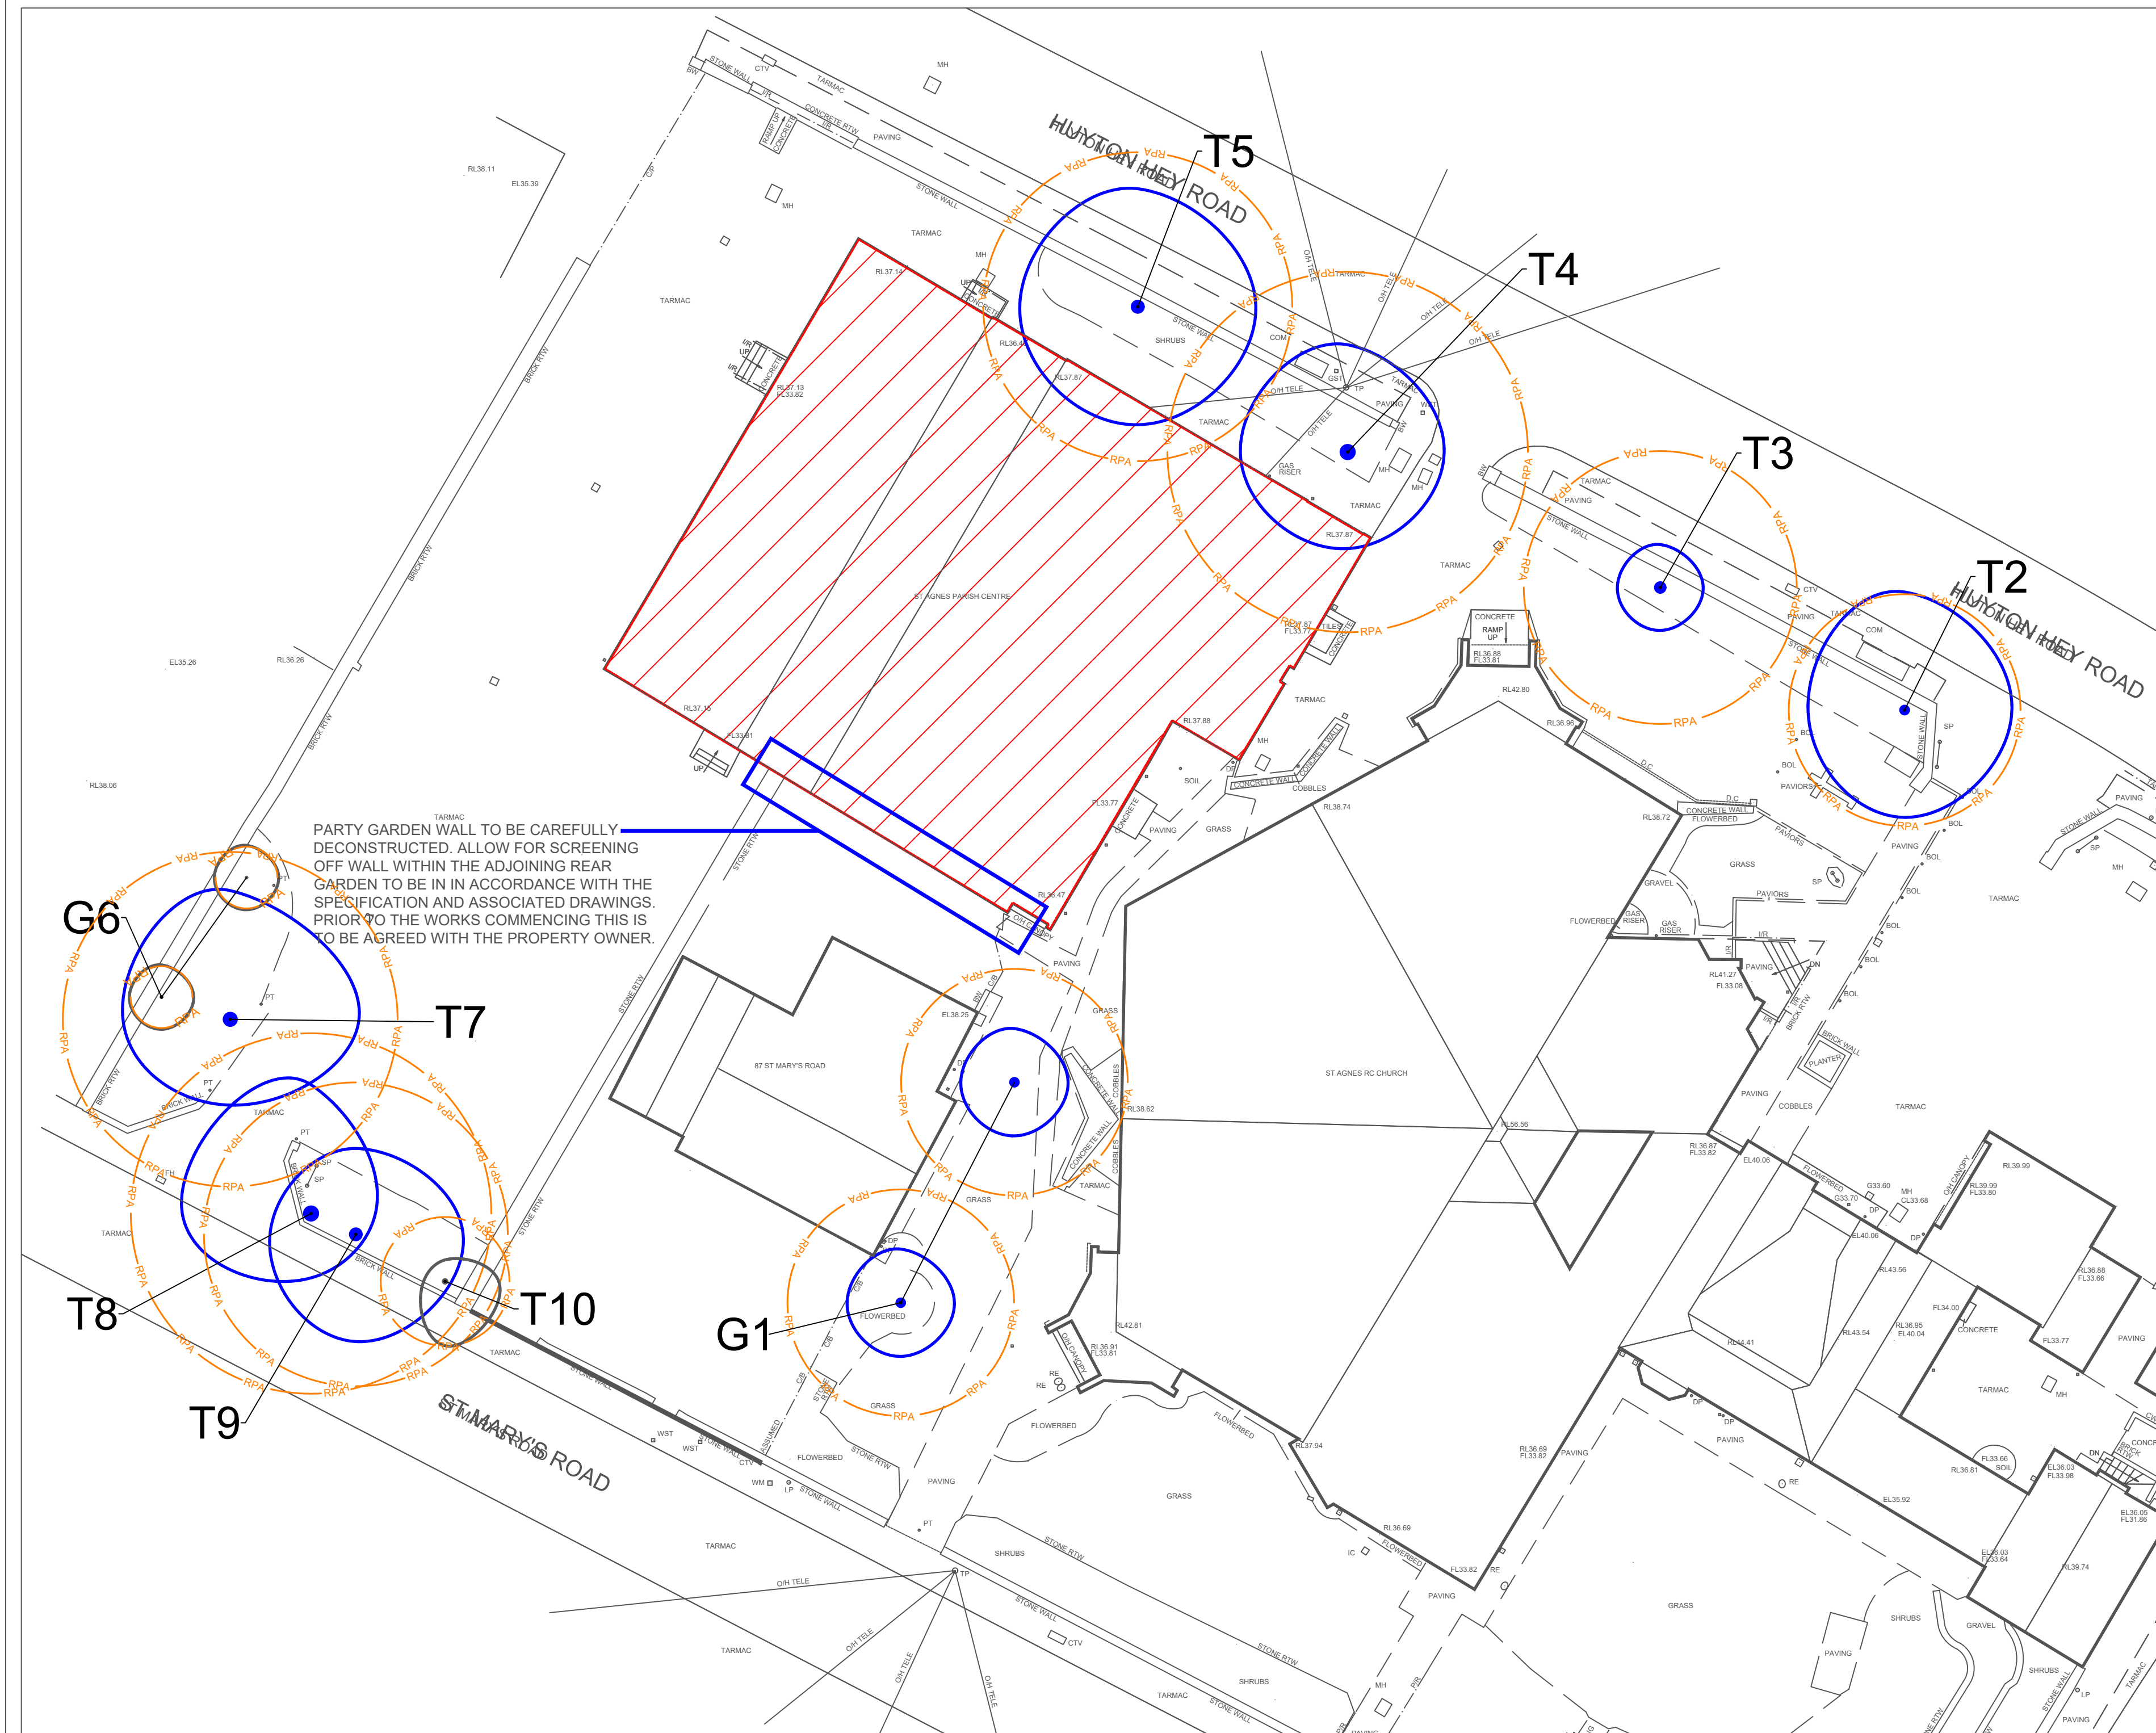

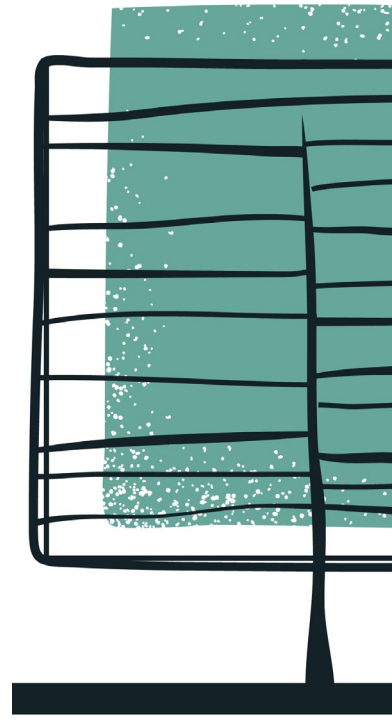

Appendix v

Pictorial Evidence



Picture 1. G1 – A group of 2 holly trees.



Picture 2. T2-Birch located in planting bed at front of St Agnes Church adjacent to Huyton Hey Road.



Picture 3. T3-Cypress located in planting bed at front of St Agnes Church adjacent to Huyton Hey Road.



Picture 4. T4- Sycamore located at the front of the parish club adjacent to Huyton Hey Road.



Picture 5. T5- Sycamore located at the front of the parish club adjacent to Huyton Hey Road.



Picture 6. G6-A holly and yew located in car park area.



Picture 7. T7-Ivy clad sycamore located in car park area.



Picture 8. T8, T9 & T10- Located in car park area at the rear of the site.



Picture 9. T8-Monterey cypress with low branches over path. Stem growth is damaging wall as shown by red circle.



Picture 10. T10-Double stemmed holly with acute basal union. Dead elderberry bush next to holly indicated by red circle.