



Arboricultural
Impact Assessment
with
Arboricultural Method Statement

**St. Helena's Residential Care Home
Roby Road
Liverpool
L36 4HE**

Project No. AIA.13809.01

12th April 2024

www.godwins.co.uk
info@godwins.co.uk
0800 030 4045

SUMMARY

Fifteen individual trees, four groups of trees/shrubs and one hedge were recorded. In accordance with *BS5837:2012 Trees in relation to design, demolition and construction* seven individual trees were recorded as retention category 'B'; and a mixture of six individual trees, four groups of trees/shrubs and one hedge were recorded as retention category 'C'.

The trees were generally found to be in good to fair condition, however, two individual trees (**T3** and **T4**) were classified as retention category 'U' (unsuitable for retention). Both trees have hazardous defects that pose a safety risk.

It is understood that trees within the site are protected by Tree Preservation Orders, but that the site is not located within a Conservation Area.

No trees shall require removal to enable the construction of the proposed development.

The retained trees will be protected to British Standard *BS5837:2012 Trees in relation to design, demolition and construction* to ensure that they remain in a healthy condition during and post-development. The *Tree Protection Plan* to the rear of this report highlights the recommended tree protection measures.

Any arboricultural work undertaken should be done so by a competent arborist in line with British Standard *BS3998:2010 Tree Work*, and after permission has been granted to do so by the local planning authority.

It is recommended that a detailed tree risk assessment is undertaken post-development to identify any potential hazards obscured during the initial tree survey and is used to inform an arboricultural management strategy. It is advisable to have trees inspected by a suitably qualified arboriculturist regularly and we would advise that trees are inspected for safety and management on an annual basis as a minimum.

CONTENTS

1. Introduction	1
1.1. Project outline	1
1.2. Scope of this report	1
1.3. Data collection.....	1
2. Arboricultural Constraints	2
2.1. Tree retention categories.....	2
2.2. Tree age class and condition	2
2.3. Root Protection Areas	3
2.4. Tree protection status	3
3. Arboricultural Impact Assessment	4
3.1. The proposed development.....	4
3.2. Proposed tree works	4
3.3. Site construction traffic and demolition works.....	4
3.4. RPA beyond the protective barriers	5
3.5. Structures within the RPA.....	5
4. Arboricultural Method Statement.....	6
4.1. Tree works prior to development.....	6
4.2. Tree protection barriers	6
 Drawing 1. Tree Constraints Plan	 8
Drawing 2. Tree Protection Plan.....	9
 Appendix 1. Tree Schedule	 10
Appendix 2. Explanatory Notes.....	11
Appendix 3. Report Limitations & General Guidelines	14
Appendix 4. Protective Barrier Construction.....	16
Appendix 5. Statutory Tree Protection Check Results	19

1. Introduction

1.1. Project outline

- 1.1.1. This report has been produced in accordance with *British Standard BS5837: 2012 Trees in relation to design, demolition and construction* to achieve a harmonious and sustainable relationship where tree retention or planting is proposed in conjunction with nearby construction (site-based operations with the potential to affect existing trees).

1.2. Scope of this report


- 1.2.1. This report has been produced to comply with planning requirements where trees are to be considered as part of a proposed development. To achieve this, arboricultural constraints have been identified and a detailed plan (*Tree Constraints Plan*) has been produced showing the location, root protection areas and retention category of trees within the site.
- 1.2.2. In addition, this report provides an *Arboricultural Impact Assessment* that evaluates the direct and indirect effects of the proposed development, and where necessary makes recommendations for mitigation measures. This report also includes *Tree Protection Measures* and a *Tree Protection Plan* as part of an outline *Arboricultural Method Statement*, which demonstrates how the retained trees will be protected during construction, and where tree protection measures are to be implemented.
- 1.2.3. Recommendations for tree works within this report are specific to the construction of the proposed development. This report does not form part of a tree safety inspection or tree management strategy, and general arboricultural management works may be required post-development. To manage the safety and risk from trees it is advised that trees are inspected in detail for this purpose by an arboriculturist using a suitable risk management strategy.

1.3. Data collection

- 1.3.1. A ground-level inspection was undertaken by Godwins on 11th April 2024. As recommended by *BS5837*, the position of all trees within the site with a stem diameter of 75mm or more, measured at 1.5m above the highest adjacent ground level is recorded. The position of trees with an estimated stem diameter of 75mm or more that overhang the site or are located beyond the site boundaries within a distance of up to 12 times their estimated stem diameter was also recorded. For individual trees the crown spread was taken at four cardinal points; for tree groups, the overall extent of the canopy was recorded.
- 1.3.2. Tree positions were plotted using a topographical plan supplied by the client, which is the basis for which the *Tree Constraints Plan* has been prepared.

2. Arboricultural Constraints


2.1. Tree retention categories

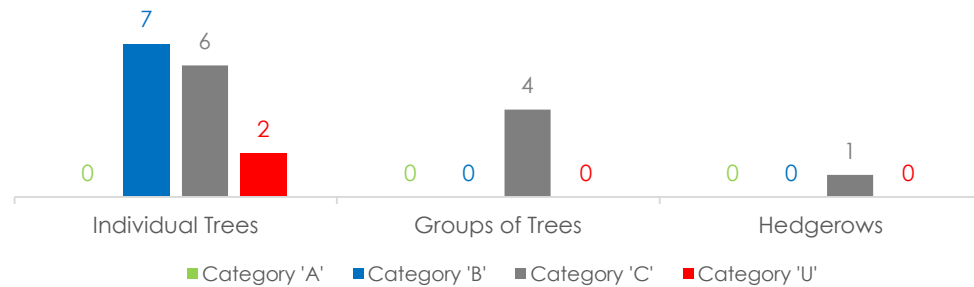

2.1.1. Fifteen individual trees, four groups of trees/shrubs and one hedge were recorded. In accordance with *BS5837:2012 Trees in relation to design, demolition and construction* seven individual trees were recorded as retention category 'B'; and a mixture of six individual trees, four groups of trees/shrubs and one hedge were recorded as retention category 'C'.

2.1.2. The trees were generally found to be in good to fair condition, however, two individual trees (**T3** and **T4**) were classified as retention category 'U' (unsuitable for retention). Both trees have hazardous defects that pose a safety risk.

2.2. Tree age class and condition

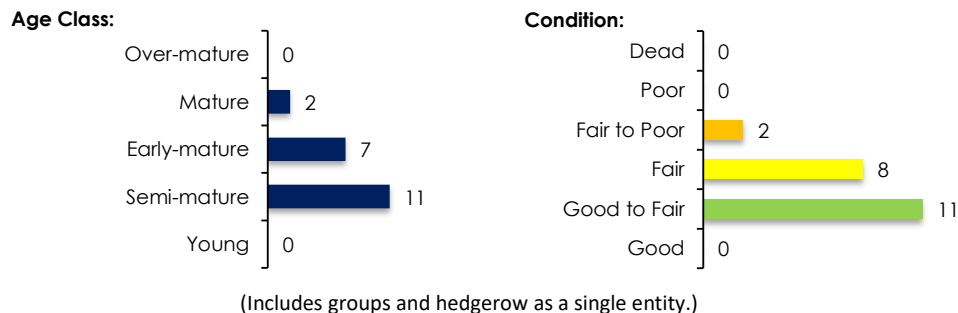

2.2.1. Please see *Appendix 1* for the detailed list of existing species, age class, dimensions and condition of trees within the site, and *Appendix 2* for an explanation of retention category criteria. Tree locations can be seen on the *Tree Constraints Plan* at the rear of this report (*Drawing 1*).

2.2.2. The inspection of several trees and groups was restricted as detailed in *Appendix 1*. The inspection of these trees was limited to a cursory observation of the parts of the trees that could be clearly observed, without obstruction, from the available vantage point. However, sufficient tree-related data was collected to fulfil the requirements detailed within the scope of this report.

- 2.2.3. Where inspections are limited by restrictions such as stem ivy, understory vegetation, limited access, epicormic growth or being located on adjacent land, any form of tree condition hazard assessment was restricted. A full assessment of the levels of risk posed by trees can only be informed by considering site use together with assessing any hazards present within a tree. Trees are dynamic structures that continue to develop and decline; in addition, changes in site use are likely to occur during and as a result of the proposed development. On this basis, it is recommended that a suitably timed, detailed tree risk assessment is undertaken post-development to identify any potential hazards obscured during the initial tree survey and is used to inform an arboricultural management strategy.
- 2.2.4. It is advisable to have trees inspected by a suitably qualified arboriculturist regularly and we would advise that trees are inspected for safety and management on an annual basis as a minimum.

2.3. Root Protection Areas

- 2.3.1. The tree Root Protection Area (RPA) is a layout design tool indicating the area around a tree that, along with the tree stem and branches, must be considered during development. The protection of the roots and soil structure within the RPA should be treated as a priority. The RPA of each tree or group is marked on the *Tree Constraints Plan* at the rear of this report.

2.4. Tree protection status

- 2.4.1. A statutory tree protection check was made with Knowsley Council on 12th April 2024. It is understood that trees within the site are protected by Tree Preservation Orders, but that the site is not located within a Conservation Area. Please see *Appendix 5* for details.
- 2.4.2. **It is essential that no tree works (including works to category 'U' trees), and no construction works that may affect retained trees, are undertaken within the site before consideration and consent of the proposed works under FULL planning approval only by the local planning authority, regardless of whether the trees are currently protected or not.**

3. Arboricultural Impact Assessment

3.1. The proposed development

- 3.1.1. Renovations to the existing building are proposed. In addition, a replacement office pod for the existing cabin and a new cycle store are proposed. The proposed layout drawing can be seen within the *Tree Protection Plan* to the rear of this report. This drawing has been used to assess the potential direct and indirect arboricultural impacts.

3.2. Proposed tree works

- 3.2.1. No trees shall require removal to enable the construction of the proposed development.
- 3.2.2. Trees **T3** and **T4** could be retained during construction as the proposed works would not cause them any harm. However, both trees are recommended for removal due to their condition.
- 3.2.3. No pruning works shall be required to enable the construction of the proposed development. Several trees may benefit from general arboricultural works as part of a practical post-development arboricultural management strategy; however, these works are not covered within the scope of this report.
- 3.2.4. Within *Appendix 1* the term 'No action required' relates specifically to those tree works required to enable the proposed development and does not mean that general post-development arboricultural management works are not required. However, general remedial pruning works have been recommended in this instance, please see *Appendix 1* for full details. The proposed works involve the removal of deadwood from several trees.

3.3. Site construction traffic and demolition works

- 3.3.1. To protect the trees from construction site traffic (including demolition works) the remaining trees should be protected by a temporary protective barrier (see *Section 4.2*), put in place before any construction activity. The barrier will ensure that the trees remain in a healthy condition during and after development.
- 3.3.2. Several of the retained trees are located beyond topographical site features, existing boundary fencing or away from the proposed development area. As such, these trees shall not require protection via temporary protective barriers as they are already protected due to their inaccessible location that is remote from the proposed construction activity.

3.4. RPA beyond the protective barriers

- 3.4.1. Sections of RPA from several retained trees extend into the proposed working area. However, it should be noted that these RPAs are currently located beneath an existing asphalt hard surface that would act to protect the RPAs from construction activity.

3.5. Structures within the RPA

- 3.5.1. The existing cabin sits on top of a flagged area, which in turn sits on top of an asphalt hard surface. The proposed office will replace the existing cabin and will be a free-standing structure, positioned on top of the existing hard surface. The proposed office pod will not require foundation excavations to construct, and electrical services are already installed. Similarly, the proposed cycle store is comprised of a metal frame that will be fixed to the existing asphalt hard surface and will not require excavations to install.

4. Arboricultural Method Statement

4.1. Tree works prior to development

- 4.1.1. Care should be taken to ensure during tree removal or remedial work that damage to the retained trees and disturbance to the RPA is avoided. All tree works, as described in *Appendix 1*, should be carried out under *BS 3998: 2010 Recommendations for tree work*, and after permission has been granted to do so by the local planning authority. It is essential that those appointed to undertake any tree works carry out adequate checks to ensure that no statutory laws are contravened during tree work operations.

4.2. Tree protection barriers

- 4.2.1. Once the tree works have been completed, all trees that may be affected by construction activity and are being retained on site should be protected by barriers before any materials or machinery are brought onto the site, and before any demolition, development or stripping of soil commences. No hardcore, rubble or soil from groundworks should be located within the protective barriers. It should be confirmed by an arboriculturist or the local authority that the barriers have been correctly set out on site, before the commencement of any other operations.
- 4.2.2. The protected area should be regarded as off limits, and once installed barriers should not be removed or altered without prior recommendation by an arboriculturist and, where necessary, approval from the local planning authority.
- 4.2.3. Please see *Appendix 4* for suggested barrier construction detail. It is recommended that in this instance the protective barrier shown in *Figure 2* would be appropriate. The suggested location for protective fencing is shown on the *Tree Protection Plan (Drawing 2)*.
- 4.2.4. Only when the development phase is complete and the site machinery has been removed, the local planning authority should be invited to inspect the site to approve the removal of the tree protection measures.

Client: Jagger, Jones & Muzzlewhite LLP
Project No: AIA.13809
Issue: 01

Date Issued: 12th April 2024
Status: FINAL

Signed on behalf of Godwins Arboricultural Limited:

R Godwin

Robert Godwin MSc, MArborA.
Arboriculturist




Contact Details:

Godwins Tree Surveys
82 King Street
Manchester
M2 4WQ

www.godwins.co.uk
info@godwins.co.uk
0800 030 4045

Drawing 1. Tree Constraints Plan



T	G	H	W	S
INDIVIDUAL TREE	GROUP OF TREES	HEDGEROW	WOODLAND GROUP	SHRUB

	EXISTING LAYOUT
--	-----------------

TREE QUALITY ASSESSMENT CATEGORY	
	CATEGORY 'A' HIGH QUALITY
	CATEGORY 'B' MODERATE QUALITY
	CATEGORY 'C' LOW QUALITY
	CATEGORY 'U' UNSUITABLE FOR RETENTION

Based on British Standard 5837:2012 Table 1.
Please refer to Appendix 2 of the arboricultural report for more detailed category definitions.

	ROOT PROTECTION AREA (RPA)
--	----------------------------

The Root Protection Area (RPA) is a layout design tool highlighting the underground tree constraints. Along with the tree stem and branches the RPA must be considered prior to and during development.


Written consent must be obtained from Godwins Arboricultural Limited before copying or using the data within this drawing other than for the purpose it was originally supplied.
Do not scale from this drawing.

GODWINS ARBORICULTURAL LIMITED
www.godwins.co.uk
info@godwins.co.uk
0800 030 4045

17 Wood Street
Bolton
BL1 1EB

PROJECT TITLE: St. Helena's, Roby Road, Liverpool, L36 4HE		
DRAWING TITLE: TREE CONSTRAINTS PLAN	SCALE: 1:200 @ A1	ISSUE DATE: 12.04.24
DRAWING NUMBER: TCP.13809	REVISION: .01	DRAWN BY: RG

Drawing 2. Tree Protection Plan



T	G	H	W	S
INDIVIDUAL TREE	GROUP OF TREES	HEDGEROW	WOODLAND GROUP	SHRUB

	EXISTING LAYOUT
	PROPOSED LAYOUT

PROPOSED TREE WORKS

	TREE PROPOSED FOR RETENTION
	TREE PROPOSED FOR PRUNING
	None
	TREE PROPOSED FOR REMOVAL (ARBORICULTURAL REASONS)
	T3 & T4
	TREE PROPOSED FOR REMOVAL (TO ENABLE DEVELOPMENT)
	None

Please refer to Appendix 1 of the Arboricultural Impact Assessment for details on tree condition and proposed works.

	ROOT PROTECTION AREA (RPA)
--	----------------------------

The Root Protection Area (RPA) is a layout design tool highlighting the underground tree constraints. Along with the tree stem and branches the RPA must be considered prior to and during development.

TREE PROTECTION MEASURES

	TEMPORARY PROTECTIVE BARRIER Refer to Appendix 4 of the Arboricultural Impact Assessment for specification details.
--	--

Written consent must be obtained from Godwins Arboricultural Limited before copying or using the data within this drawing other than for the purpose it was originally supplied.
Do not scale from this drawing.


GODWINS ARBORICULTURAL LIMITED

www.godwins.co.uk
info@godwins.co.uk
0800 030 4045

17 Wood Street
Bolton
BL1 1EB

PROJECT TITLE:
St. Helena's, Roby Road, Liverpool, L36 4HE

DRAWING TITLE: TREE PROTECTION PLAN	SCALE: 1:200 @ A1	ISSUE DATE: 12.04.24
DRAWING NUMBER: TPP.13809	REVISION: .01	DRAWN BY: RG

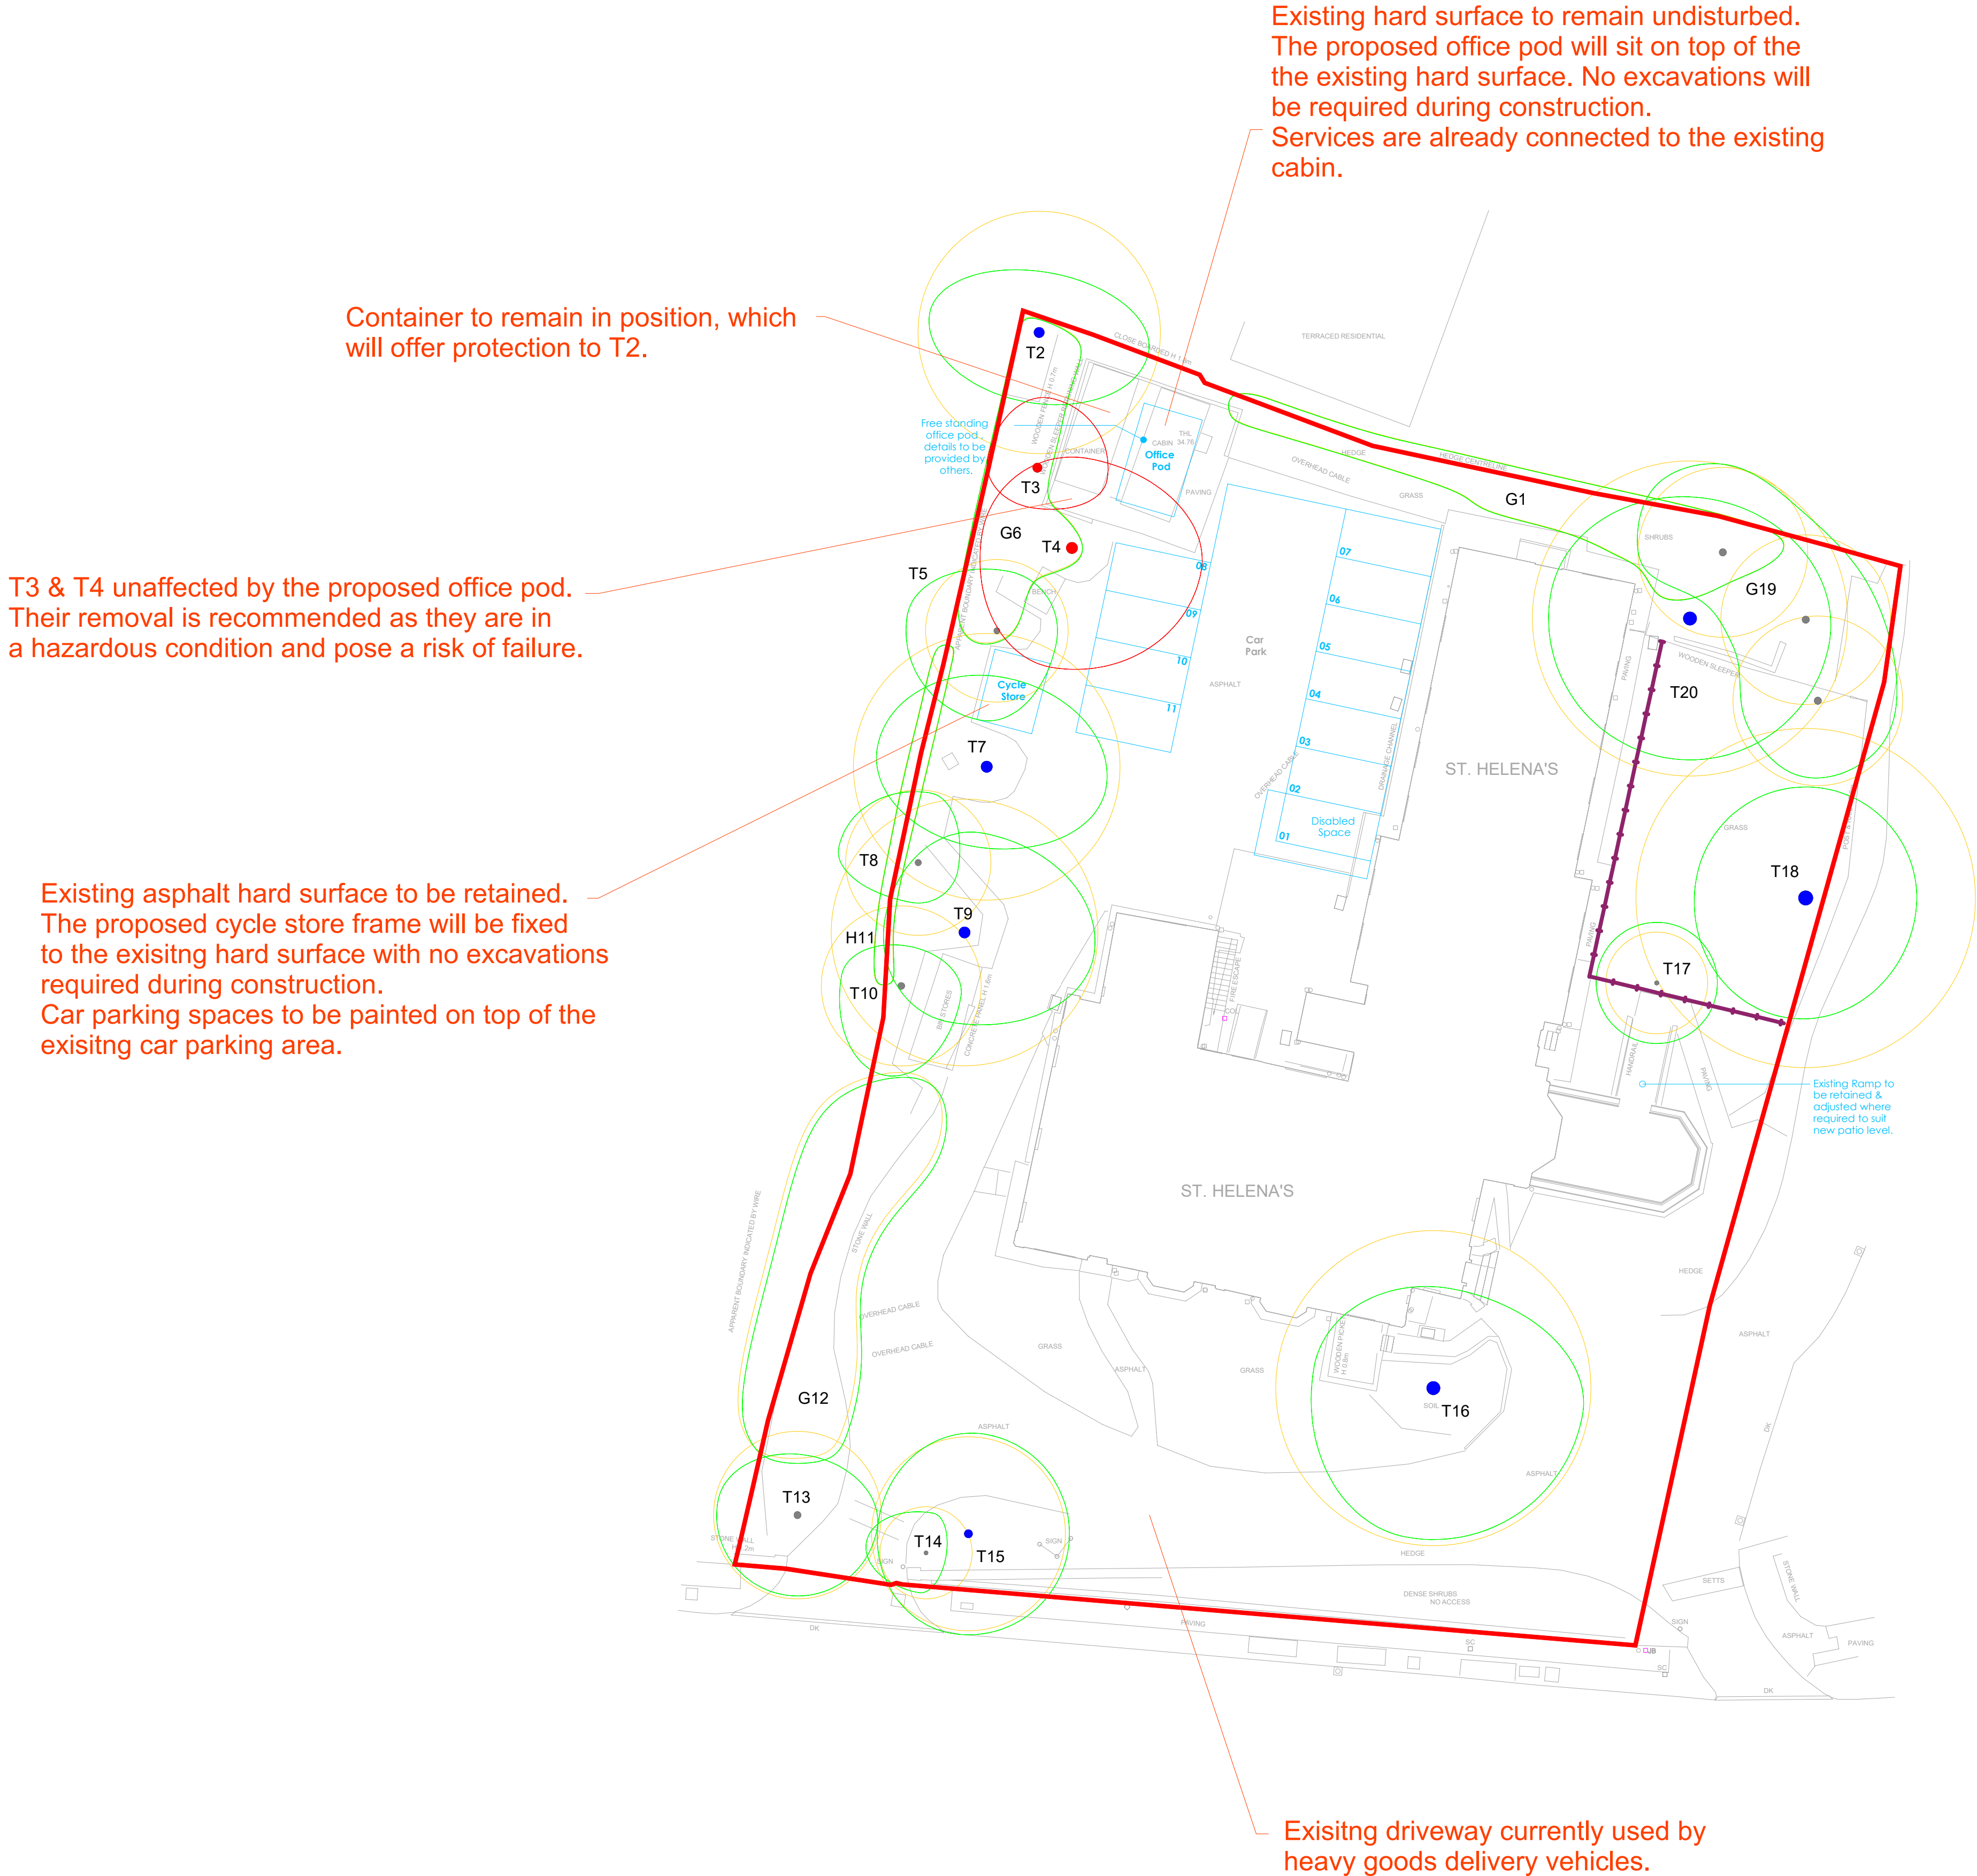

Appendix 1. Tree Schedule

Tree No.	Species	Age	Stems at 1.5m	Stem Dia (mm)	Height (Crown Hgt) (m)	FSB (D) (m)	Branch Spread (m)				Observations	Cond	Life Exp	Tree Works Required to Enable Development	Root Protection Area (RPA)		Retention Category
							N	E	S	W					Radius (m)	Area (m ²)	
G 1	Prunus lusitanica (Portugal Laurel), Garrya	Semi-mature	1	90	1.5(0)	0(S)	1	1	1	1	Limited inspection - dense ivy on stem/base. Individuals crowns restricted by group. Linear boundary group.	Good to Fair	20+	No action required.	1.1	3.7	C
T 2	Tilia X europaea (Common Lime)	Early-mature	1	500	15(3)	2(E)	3	5.5	3.5	5.5	Asymmetrical crown. Limited inspection - epicormic growth. Limited inspection - dense ivy on stem/base. Limited inspection - situated on adjacent land. Tree RPA located within ground level change. Tree RPA located within existing hard surface area.	Good to Fair	40+	No action required.	6.0	113.1	B
T 3	Acer pseudoplatanus (Sycamore)	Early-mature	1	450	9(3)	3(E)	3.5	3.5	2	2.5	Unbalanced crown. Limited inspection - dense ivy on stem/base. Tree RPA located within ground level change. Tree RPA located within existing hard surface area. Large cavity in stem >30%.	Fair to Poor	<10	No action required for development. Remove for arboricultural reasons.	5.4	91.6	U
T 4	Acer pseudoplatanus (Sycamore)	Early-mature	1	550	17(5)	5(E)	4.5	6.5	6	4.5	Asymmetrical crown. Crown - minor deadwood (less than 50mm). Limited inspection - dense ivy on stem/base. Tree RPA located within ground level change & existing hard surface area. Decay fungus at base (Ganoderma).	Fair to Poor	<10	No action required for development. Remove for arboricultural reasons.	6.6	136.9	U
T 5	Acer pseudoplatanus (Sycamore)	Semi-mature	2	170 240	10(3)	5(E)	3	3	4.5	4.5	Crown - minor deadwood (less than 50mm). Twin-stemmed from ground level. Limited inspection - restricted access. Limited inspection - dense undergrowth. Crown suppressed by adjacent tree. Tree RPA located within existing hard surface area.	Fair	10+	Remove individual dead, defective or diseased branch(es).	3.5	39.2	C
G 6	Prunus lusitanica (Portugal Laurel)	Semi-mature	3	50	2.5(0)	0(E)	1	1	1	1	Multi-stemmed from ground level. Limited inspection - dense undergrowth. Individuals crowns restricted by group. Linear boundary group.	Good to Fair	20+	No action required.	1.0	3.4	C
T 7	Acer pseudoplatanus (Sycamore)	Early-mature	1	550	14(4)	4(E)	4.5	6	4	5.5	Asymmetrical crown. Crown - minor deadwood (less than 50mm). Limited inspection - dense ivy on stem/base. Tree RPA located within ground level change. Tree RPA located within existing hard surface area.	Good to Fair	40+	Remove individual dead, defective or diseased branch(es).	6.6	136.9	B
T 8	Acer pseudoplatanus (Sycamore)	Semi-mature	1	300	10(4)	5(N)	3.5	2	2	4	Unbalanced crown. Tree RPA located within ground level change. Tree RPA located within existing hard surface area.	Fair	40+	No action required.	3.6	40.7	C
T 9	Acer platanoides (Norway Maple)	Early-mature	1	550	11(5)	5(N)	5	6.5	4.5	4	Asymmetrical crown. Tree RPA located within ground level change. Tree RPA located within existing hard surface area.	Good to Fair	40+	No action required.	6.6	136.9	B
T 10	Acer pseudoplatanus (Sycamore)	Semi-mature	1	330	10(4)	5(N)	2	3	4.5	3	Asymmetrical crown. Tree RPA located within ground level change. Tree RPA located within existing hard surface area.	Fair	40+	No action required.	4.0	49.3	C

Tree No.	Species	Age	Stems at 1.5m	Stem Dia (mm)	Height (Crown Hgt) (m)	FSB (D) (m)	Branch Spread (m)				Observations	Cond	Life Exp	Tree Works Required to Enable Development	Root Protection Area (RPA)		Retention Category
							N	E	S	W					Radius (m)	Area (m ²)	
H 11	Crataegus monogyna (Hawthorn)	Semi-mature	3	25	1.5(0)	0(E)	0.5	0.5	0.5	0.5	Linear boundary hedge.	Fair	40+	No action required.	0.5	0.9	C
G 12	Crataegus monogyna (Hawthorn), Acer pseudoplatanus (Sycamore), Cupressus sp. (Cypress)	Semi-mature	1	250	9(0)	4(E)	3	3	3	3	Individuals crowns restricted by group. Linear boundary group. Tree RPA located within ground level change. Tree RPA located within existing hard surface area.	Fair	40+	No action required.	3.0	28.3	C
T 13	Acer pseudoplatanus (Sycamore)	Semi-mature	3	200	9(2)	5(E)	3	4	4	4	Multi-stemmed from ground level. Limited inspection - restricted access. Limited inspection - dense undergrowth. Limited inspection - dense ivy on stem/base. Tree RPA located within ground level change. Tree RPA located within existing hard surface area.	Fair	40+	No action required.	4.2	54.1	C
T 14	Acer pseudoplatanus (Sycamore)	Semi-mature	1	190	8(3)	5(W)	2	1	2	3	Unbalanced crown. Limited inspection - restricted access. Limited inspection - dense undergrowth. Tree RPA located within ground level change. Tree RPA located within existing hard surface area.	Fair	40+	No action required.	2.3	16.3	C
T 15	Acer platanoides (Norway Maple)	Early-mature	1	400	10(4)	4(N)	5	5	5	4.5	Asymmetrical crown. Occasional pruning wounds. Limited inspection - restricted access. Limited inspection - dense undergrowth. Tree RPA located within ground level change. Tree RPA located within existing hard surface area.	Fair	40+	No action required.	4.8	72.4	B
T 16	Taxus baccata (Yew)	Early-mature	1	650	11(3.5)	3.5(S)	5	7.5	7.5	6	Unbalanced crown. Multiple pruning wounds. Tree RPA located within existing hard surface area.	Good to Fair	40+	No action required.	7.8	191.2	B
T 17	Aesculus hippocastanum (Horse Chestnut)	Semi-mature	1	210	7.5(3)	3(S)	3	3	3	3	Balanced crown.	Good to Fair	40+	No action required.	2.5	20.0	C
T 18	Tilia X europaea (Common Lime)	Mature	1	700	17(4.5)	4.5(S)	5.5	5.5	6	5.5	Asymmetrical crown. Multiple pruning wounds.	Good to Fair	40+	No action required.	8.4	221.7	B
G 19	Tilia X europaea (Common Lime), Acer pseudoplatanus (Sycamore)	Semi-mature	1	350	12(4)	4(S)	4.5	4.5	4.5	4.5	Not inspected - located away from the proposed development area. Individuals crowns restricted by group.	Good to Fair	40+	No action required.	4.2	55.4	C
T 20	Tilia X europaea (Common Lime)	Mature	1	650	18(8)	8(S)	6	7	7	7	Asymmetrical crown. Not inspected - located away from the proposed development area.	Good to Fair	40+	No action required.	7.8	191.2	B

Appendix 2. Explanatory Notes

A2.1. Tree statistics and measurements

Survey record	Description
<i>Tree No.</i>	Unique tree reference number. (T) = Individual tree, (G) = Group of trees or woodland that form cohesive arboricultural features, (H) = Hedgerows and substantial internal or boundary hedges.
<i>Species</i>	Species listed by scientific name, with (common name).
<i>Age</i>	Life stage – Young, Semi-mature, Early-mature, Mature, Over-mature and Veteran.
<i>Stem Count</i>	The number of stems recorded at 1.5m above ground level.
<i>Stem Diameter</i>	Stem diameter recorded in millimetres at 1.5 meters above the ground. Where the tree is multiple-stemmed, each stem has been recorded.
<i>Height (Crown Height)</i>	Height of the tree in metres – to the closest 0.5m. Average canopy height in brackets, e.g. 10(3).
<i>First Significant Branch</i>	Existing height above ground level of first significant branch and direction of growth, e.g. 3(N)
<i>Branch Spread</i>	Branch spread, taken as a minimum at the four cardinal points – North, East, South and West.
<i>Observations</i>	General observations, particularly of structural and/or physiological condition (e.g. the presence of any decay, physical defect or historic pruning).
<i>Cond</i>	Condition of the tree recorded as Good, Good to Fair, Fair, Fair to Poor, Poor or Dead.
<i>Life Exp</i>	Life Expectancy - classed as less than 10 years, 10 plus years, 20 plus years, or more than 40 years.
<i>Tree Works Required to Enable Development</i>	Tree works specifically required to enable the proposed development, or to reduce significant risk of harm. The term 'No action required' does not mean that general post-development arboricultural management works are not required.
<i>RPA Radius</i>	The radius of the root protection area, when plotted as a circle centred on the base of the stem.
<i>RPA Area</i>	The total area of RPA in metres squared, e.g. 100m ² .
<i>Retention Category</i>	See below – A2.2.

A2.2. Tree retention categories

Retention category and definition	Criteria
<i>U (marked in red on the Tree Constraints Plan) = trees for removal.</i>	Trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years.
<i>A (marked green on the Tree Constraints Plan) = Trees of high quality</i>	Trees of high quality with an estimated remaining life expectancy of at least 40 years.
<i>B (marked in blue on the Tree Constraints Plan) = Trees of moderate quality</i>	Trees of moderate quality with an estimated remaining life expectancy of at least 20 years.
<i>C (marked in grey on the Tree Constraints Plan) = Trees of low quality</i>	Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm.

Appendix 3. Report Limitations & General Guidelines

- A3.1 Where the inspection of trees was limited (*see Appendix 1*), the 'Tree statistics and measurements' (*Appendix 2.1*) are estimated, and observations, condition and life expectancy are based on an inspection from the available vantage point.
- A3.2 It is recommended that qualified and experienced companies are sought when appointing tree work contractors and they should be approved under the Arboricultural Association Approved Contractors scheme. It is essential that all appointed tree work contractors have adequate Public Liability, Products Liability and Employers Liability Insurance. All tree works must conform to the current BS 3998 "*Recommendations for Tree Work*".
- A3.3 Godwin's Arboricultural Ltd will not accept liability for works undertaken by third-party companies. All necessary checks must be made by the appointed tree work contractor before undertaking any works to ensure that no statutory tree protection measures or relevant laws are contravened.
- A3.4 The validity, accuracy and findings of this report are directly related to the accuracy of the information made available before and during the inspection process. No checking of independent third-party data will be undertaken. Godwin's Arboricultural Ltd will not be responsible for the recommendations within this report where essential data are not made available or are inaccurate.
- A3.5 The assessment and works recommendations relate to conditions found at the time of our inspection. Any significant alteration to the site post our site inspection but pre-submission for planning that may affect the trees present, or have a bearing on the planning implications (including level changes, hydrological changes, storms, extreme climatic events or site works) will necessitate a re-assessment of the trees and the site.
- A3.6 This report has been carried out to inform the planning process, and not to assess the potential hazards and risks posed by trees. Where clear and obvious hazards have been observed to accessible trees, these have been addressed in the recommendations of the work. Where inspections were limited by restrictions such as stem ivy, understory vegetation, limited access, epicormic growth or being located on adjacent land, any form of tree condition assessment was restricted. A full assessment of the levels of risk posed by trees can only be informed by considering site use together with assessing any hazards present within a tree.
- A3.7 Trees are dynamic structures that continue to develop and decline; in addition, changes in site use are likely to occur during and as a result of the proposed development. On this basis, regular tree risk assessments are advised.
- A3.8 Godwin's Arboricultural Ltd plans are to scale whenever possible, but care should be taken when measuring from a plan without first checking the original data.

Appendix 4. Protective Barrier Construction

- A4.1 The default specification for protective barriers should consist of a vertical and horizontal scaffold framework, well-braced to resist impacts, as illustrated below. The vertical tubes should be spaced at a *maximum* interval of 3 m and driven securely into the ground. Onto this framework, welded mesh panels should be securely fixed. Care should be exercised when locating the vertical poles to avoid underground services and, in the case of the bracing poles, also to avoid contact with structural roots.

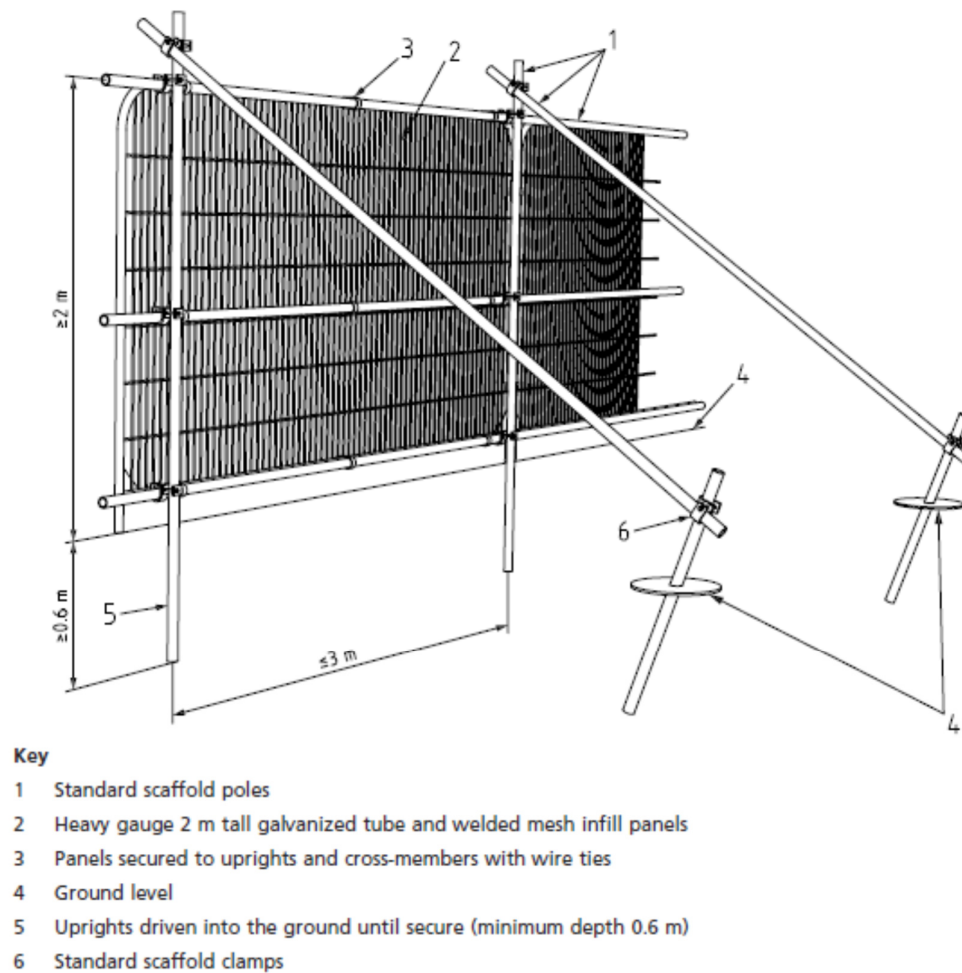


Figure 1. Default protective fencing barrier as detailed in BS 5837: 2012.

- A4.2 Where the site circumstances and associated risk of damaging incursion into the RPA do not necessitate the default level of protection, an alternative specification may be adopted. This system includes 2 m tall welded mesh panels on rubber or concrete feet, secure enough to provide an adequate level of protection from cars, vans, pedestrians and manually operated plant. In such cases, the fence panels should be joined together using a minimum of two anti-tamper couplers, installed so that they can only be removed from inside the fence. The distance between the fence couplers should be at least 1 m and should be uniform throughout the fence. The panels should be supported on the inner side by stabilizer struts, which should normally be attached to a base plate secured with ground pins (Figure 2a). Where the fencing is to be erected on retained hard surfacing or it is otherwise unfeasible to use ground pins, e.g. due to the presence of underground services, the stabilizer struts should be mounted on a block tray (Figure 2b).

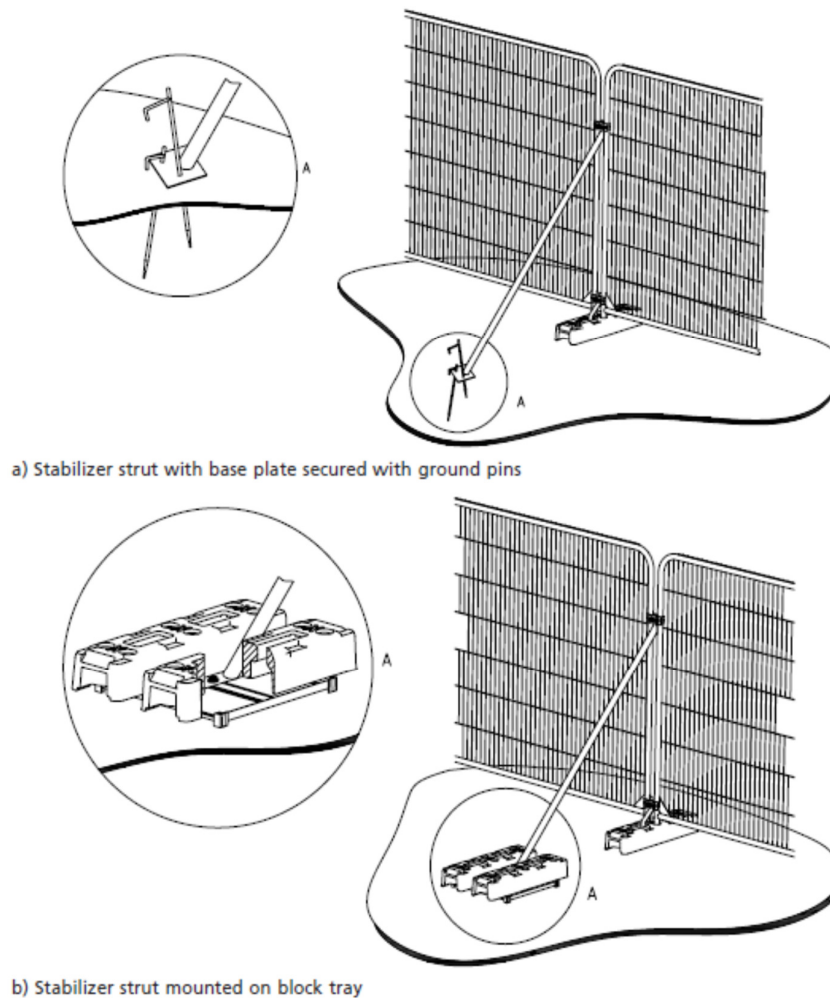


Figure 2. Examples of above-ground stabilizing systems

Appendix 5. Statutory Tree Protection Check Results

My neighbourhood

- [My property](#)
- [Education](#)
- [Environment](#)
- [Electoral](#)
- [Health](#)
- [Leisure](#)
- [Planning](#)
- [Get online](#)

Planning Information

Property is not a Listed Building

Show on Map

Property not in a Conservation Area

Remove from Map


Planning Applications

Planning Application No	Date	Distance
-------------------------	------	----------

Tree Preservation Orders

Remove from Map

TPO No	Location
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE
undefined	St Helenas Residential Home 6 Roby Road Roby Knowsley L36 4HE

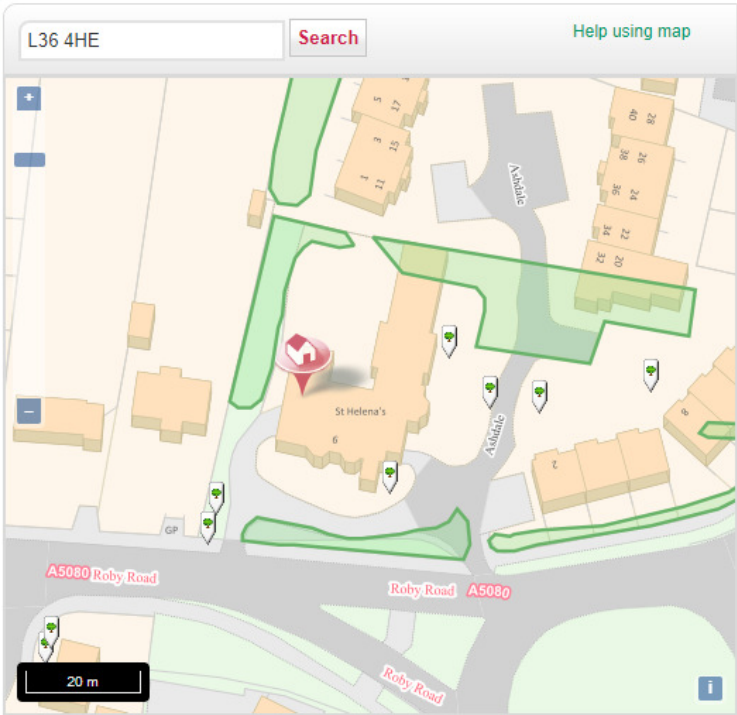

v1.2.10 (last updated 15/11/2016)

Godwins Arboricultural Limited © 2024
Tree Surveys and Tree Reports

info@godwins.co.uk | www.godwins.co.uk