


GENERAL NOTES

1. Do not scale from this drawing. Use figured dimensions only. Unless otherwise stated all drawing units are in millimetres. Levels are in meters.
2. This drawing to be read in conjunction with all other relevant consultant/specialist drawings and specifications.
3. Check levels/dimensions quoted on drawing against those on site before finalising.
4. Report any discrepancies before affected work commences.
5. For setting out dimensions, see Architect's drawings.
6. This drawing remains copyright of Blackett-Ord Conservation Ltd. Copy/distribute only with consent of the Author.

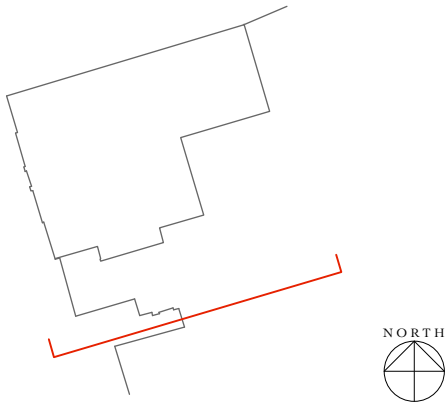


KEY PLAN
1:500 @ A3

KEY

[D1] REFERENCE TO STRUCTURAL DEFECT

STRUCTURAL DEFECTS:

Ref.	STRUCTURAL DEFECT
D	ELEVATION D
D1	Refer to Elevation A – A1. Ridgeline sags.
D5	Bed joints lean in/down to either side of the boundary between old and new, bricks have been replaced this side.
D7	Stone lintel with timber lintel above
D11	5mm diagonal crack from cill of blocked window
D16	Refer to Elevation B – B10. Open perpend joint in coping.
D17	Existing steel escape staircase not fit for purpose

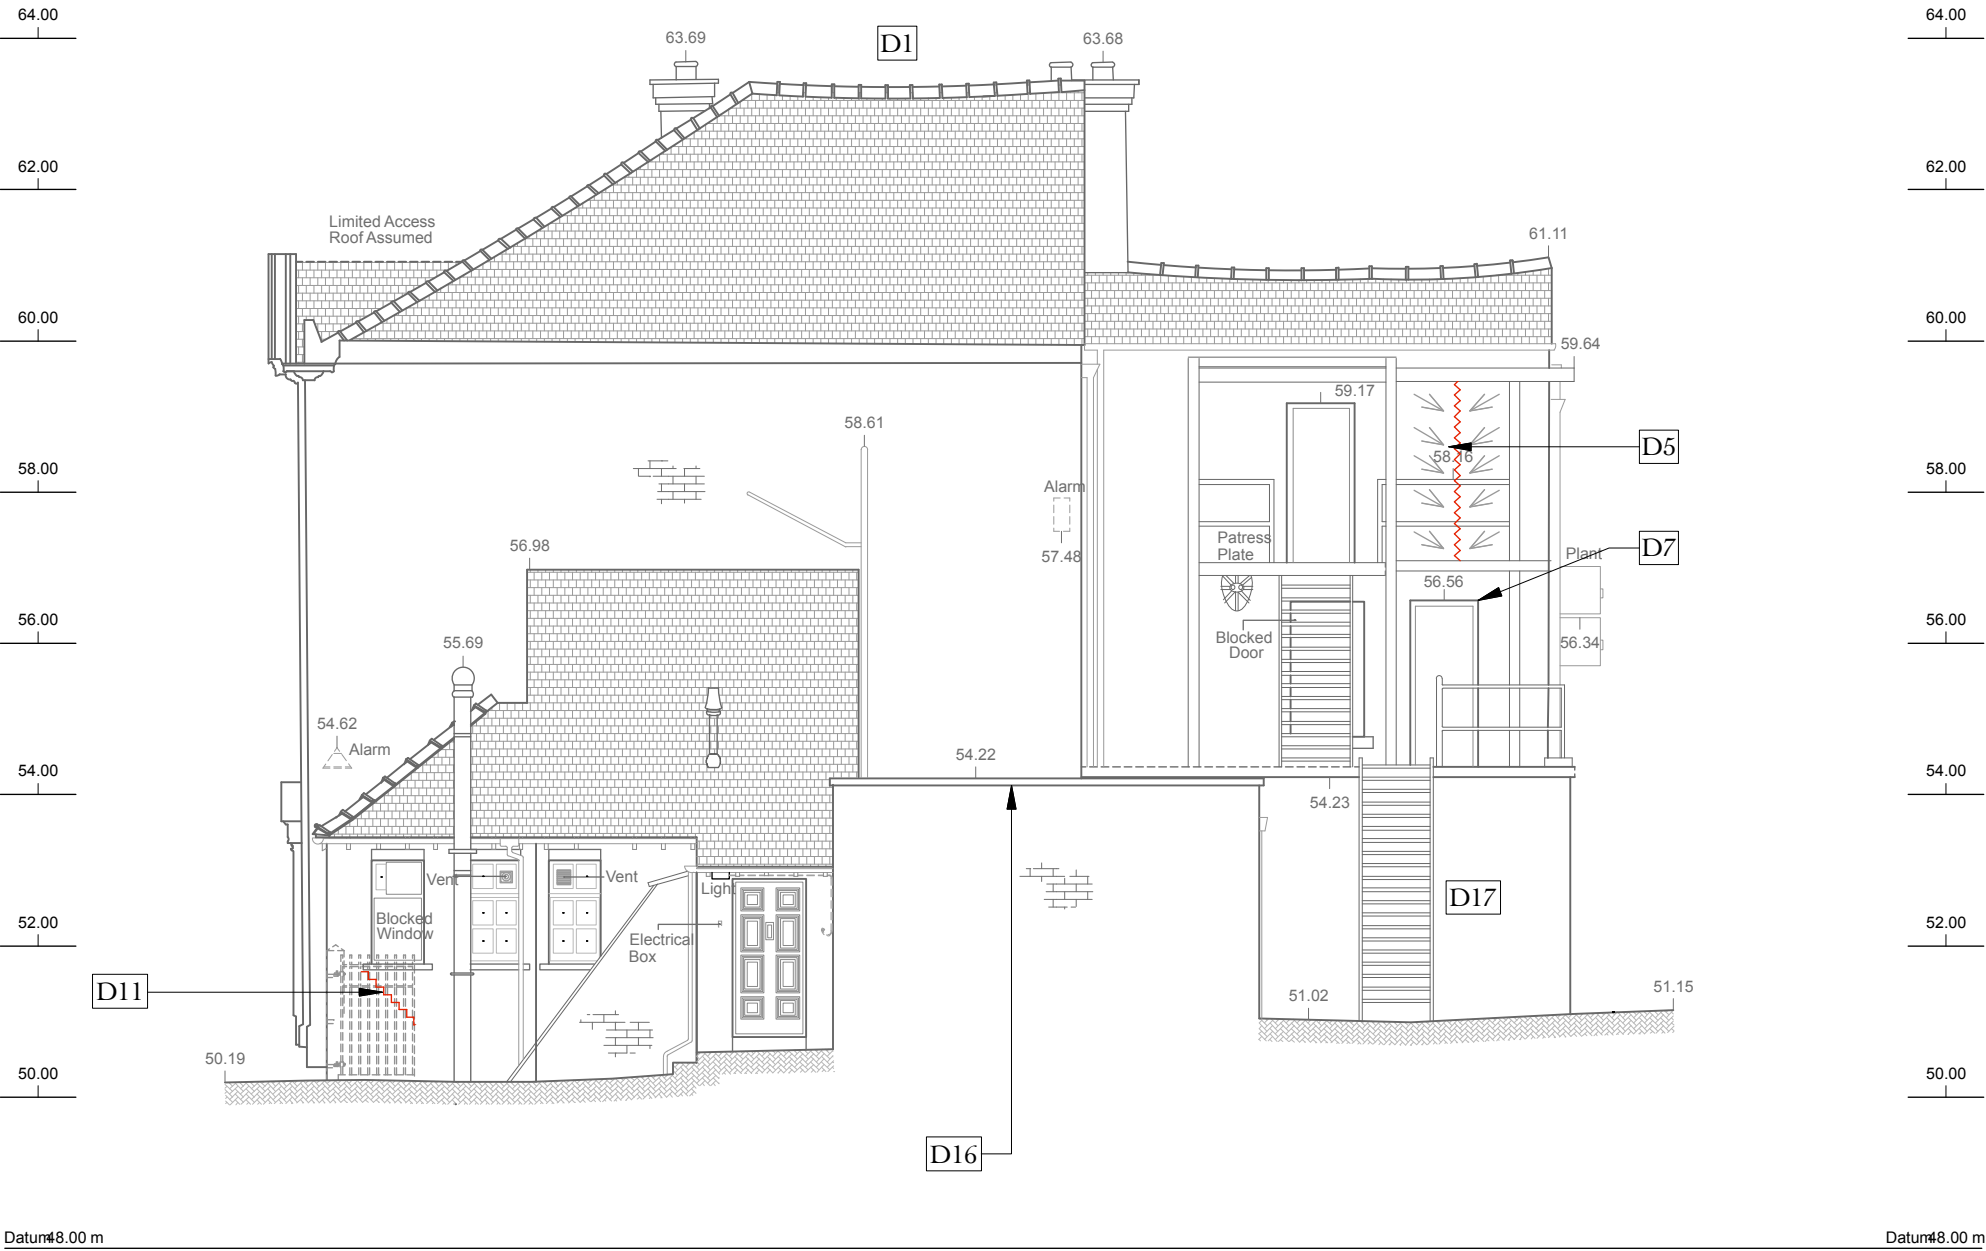

 **Blackett-Ord Conservation**
ENGINEERING

33 Chapel Street, Appleby, Cumbria CA16 6QR - Telephone: 017683 52572
Email: engineering@blackett-ordconservation.co.uk

Cockpit House, Prescott
for Purcell

Elevation D

Drawing No: X54/107 Rev: - Scale: 1:100 @ A3 Date: October 2021