

Rainfords Tree Care

19 Derby Drive, St Helens, WA11 8EX
07841128366 | robert@rainford.com

Millbrook Manor, Tree Protection Plan


SCALE :
1 : 242 @ A3

DATE :
26/01/2022



MAP FILENAME :
Millbrook Manor TPP

Map data shown may contain Ordnance Survey © products supplied by
Pear Technology Services Ltd; Email: info@peartechnology.co.uk
© Crown Copyright and database rights from date shown above
Ordnance Survey © licence number 100023148

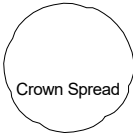

Category 'A'

Category 'B'

Category 'C'

Category 'U'



T9 RPA Area: 40.67m2
Encroachment:
1.6% Encroachment

T10 RPA Area: 40.67m2
Encroachment: 0.4m2
<1% Encroachment

T7 RPA Area: 35.51m2
Encroachment: 5.03m2
14% Encroachment

HERAS Fencing should be erected to
create boundary between work and trees.

1.2m Ground Mat width around
RPA Perimeter Fence

Ground Matting suitable for supporting light
machinery and foot traffic should be placed
between HERAS panels and proposed hard
surfaces to create a low compaction zone
over rooting areas, creating a useable working
envelope on site.

Area along hedge does not require
protective fencing, shipping containers and
hard surfacing already in place.

SLEY LANE B5202

OLD MEADOW

Legend

- Hard_Surfaces
- Soft Landscape
- Building
- Proposed Hard Surfaces (Approx)
- Proposed House (Approx)
- Proposed Garage (Approx)
- RPA Encroachment
- Ground Matting Coverage
- Site_Boundary
- Proposed Site Extents (Approx)
- HERAS Fencing Location

N.B. Proposed plans are shown as
approximate due to hand drawn plans bring
provided, care has been taken to reproduce
to good accuracy and close measurements
however may not be fully accurate. Building
measurements in relation to trees should be
taken from the Architects plans accordingly.