

Tree Survey and Constraints Report

Halsnead Farm

Report prepared for Starship Hub

NAME OF SITE:	Halsnead Farm, Fox's Bank Lane, Whiston, Widnes, Prescot L35 3SU
PROJECT No:	12449
CLIENT NAME:	Starship Hub
SPECIALIST:	Amenity Tree Care Ltd
DATE PREPARED:	07.07.2025
PREPARED BY:	Paul Springett
REVIEWED BY:	Chris Gaughan
DATE REVIEWED:	07.07.2025
VERSION CONTROL:	Version 1

Contents

1.0 Instruction	3
2.0 Report Limitations	4
3.0 Methodology and data collection	5
4.0 Arboricultural constraints.....	6
5.0 Summary	6
6.0 Conclusions and arboricultural risks and constraints	7
7.0 Recommendations	8
 Appendices	 7
Appendix 1 Survey key	
Appendix 2 BS5837 Cascade Chart.....	
Appendix 3 Survey Schedule	
Appendix 4 Tree Constraints Plan	

1.0 Instruction

- 1.1 Amenity Tree Care has been instructed by Starship Hub to prepare the following Tree Constraints Report for land at Halshead Farm, Fox's Bank Lane, Whiston, Widnes, Prescot L35 3SU
- 1.2 The survey was conducted using the client supplied topographical data, which was issued by Starship Hub.
- 1.3 The tree constraints report was carried out in line with the recommendations in BS 5837:2012 *Trees in relation to design, demolition and construction – Recommendations* and evaluates the direct and indirect impacts of the current tree population.
- 1.4 The constraints assessment considers constraints posed above and below ground and should be used to inform any future design layout.
- 1.5 Further consideration will be required at the design stage in the form of an impact assessment that evaluates the direct and indirect effects of any proposed design and where necessary will recommend mitigation.
- 1.6 Below ground constraints are influenced by the root protection area and are determined in line with the recommendations set out in BS 5837:2012. These recommendations quantify the root protection area based on a measured stem diameter in accordance with Annex C, and the root protection area determined from Annex D of BS 5837:2012.
- 1.7 It is important to understand that when considering the root protection area with regards to the circular plot as delineated on the tree protection plan that a number of site factors can influence root morphology and disposition of tree roots. Root morphology is considered when determining the impacts of the proposed development on existing woody vegetation.
- 1.8 Above ground constraints are considered in line with the recommendations in BS 5837:2012 and include shade dominance, current and future crown spread as well as the ultimate height of those retained trees.

2.0 Report Limitations

- 2.1 The inspection has been carried out from ground level only, using visual observation. Where a more detailed inspection is required, this is highlighted in the recommendations.
- 2.2 Trees are living organisms whose health and condition can change rapidly. The health, condition and safety of trees should be checked on a regular basis, preferably at least once a year. The conclusions and recommendations in this report are only valid for a period of twelve months from the date of this report. This period of validity may be reduced in the case of any change in conditions to or in proximity to the tree.
- 2.3 A desktop search of the Knowsley Council Interactive Map for Tree Preservation Orders has confirmed the site is subject to TPO's as shown in Fig.1 and Fig.2 below. The site does not fall within a Conservation Area.

<https://secured.knowsley.gov.uk/myneighbourhood#>

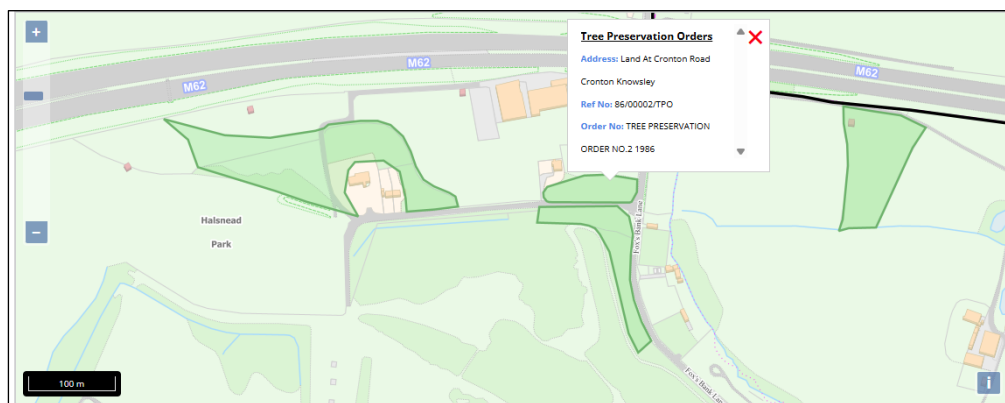


Fig. 1

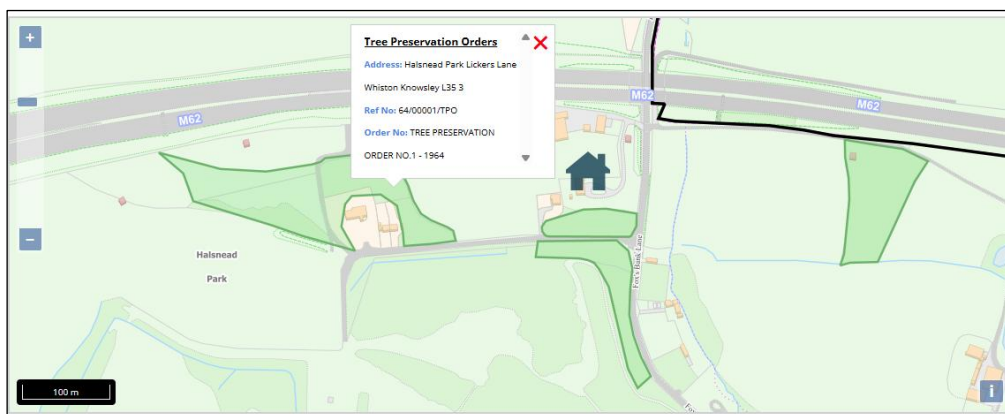


Fig.2

- 2.4 Any legal descriptions or information given to the consultant are understood to be accurate.
- 2.5 No responsibility is assumed by Amenity Tree Care Ltd for legal matters that may arise from this report and the consultant shall not be required to give testimony or to attend court unless subsequent contractual arrangements are made.
- 2.6 Any alteration or deletion from this report will invalidate it as a whole and the conclusions of this report will remain valid for twelve months from the date of the inspection.
- 2.7 The responsibility for any tree work(s) undertaken on the surveyed trees rests with the land managers.

3.0 Methodology and data collection

- 3.1 The site was visited as indicated above and the trees were assessed visually utilising the Visual Tree Assessment methodology (Mattheck, C., et al.).
- 3.2 Each individual tree has been assessed with general regard to condition, health and structural suitability and commented upon in the report.
- 3.3 An individual and group schedule is appended to this report and includes detailed information relating to tree height *both current and future*, stem diameters, crown dimensions and estimated remaining contribution.
- 3.4 Where dimensions have been recorded the following measurement conventions have been observed
 - a) Height, crown spread, and crown clearance have been recorded to the nearest half metre (crown spread has been rounded up) for dimensions up to 10m and the nearest whole meter for dimensions over 10m.
 - b) Stem diameters have been recorded in millimetres and rounded to the nearest 10mm
 - c) Where dimensions have been estimated (*e.g. for those trees located off site or where access is restricted, and accurate data cannot be recorded*) these trees will be suffixed with #.
- 3.5 Where necessary recommendations for remedial tree works (Preliminary Management Recommendations) are provided on the basis of the tree(s) current condition.
- 3.6 Trees growing as groups or woodland have been identified and assessed by the arboriculturist. An assessment has been undertaken of the individual trees within the group/woodland in order to determine the category score and aid future management plans.
- 3.7 Trees that have not been identified on the topographical survey have been plotted by eye on site and identified as such on the tree survey schedule (#).

4.0 Arboricultural Constraints

- 4.1 Below ground constraints are influenced by the root protection area (RPA) and are determined in line with the recommendations set out in section 4.6 of BS 5837:2012. These recommendations quantify the RPA based on a measured stem diameter in accordance with Annex C, and the RPA determined from Annex D. The RPA for trees with two to five stems are assessed using the calculation in 4.6.1. It is important to understand that when considering the RPA with regards to the circular plot that a number of site factors can influence the root morphology and disposition of tree roots as stated in section 4.6.3 of BS 5837:2012. Trees that form the leading edge of groups/woodland are recorded at intervals along the woodland/group edge in order to accurately plot a root protection area. All these factors must be considered when contemplating the impacts of the potential development on existing woody vegetation.
- 4.2 Above ground constraints posed by existing trees can significantly affect the proposed land use and the subsequent condition will be considered by the planning officer should the development be allowed to proceed. Above ground, constraints are considered in line with the recommendations in section 5.2 of BS 5837:2012 and include shade dominance, current and future crown spread as well as the ultimate height of those retained trees.

5.0 Summary


Category A	Category B	Category C	Category U
T25, T27, T28, T29, W1, W2	T1, T2, T3, T4, T5, T7, T8, T9, T10, T11, T12, T13, T14, T15, T17, T18, T19, T20, T21, T23, T24, T26, G1, G2, G3	T6, H1	T16, T22
Summary: A total of 29 trees, 3 groups, 1 hedge and 2 woodlands were surveyed across the site			

Note: Please refer to tree survey schedule for detailed dimensions and specific site comments

Of the individual trees recorded:

4 trees and 2 woodlands were a Category A,
22 trees, and 3 groups were Category B,
1 tree, and 1 hedge were Category C,
2 trees were Category U.

Chart 1 below shows the distribution of the quality categories according to the British Standard (5837) that have been recorded for individual trees and groups.

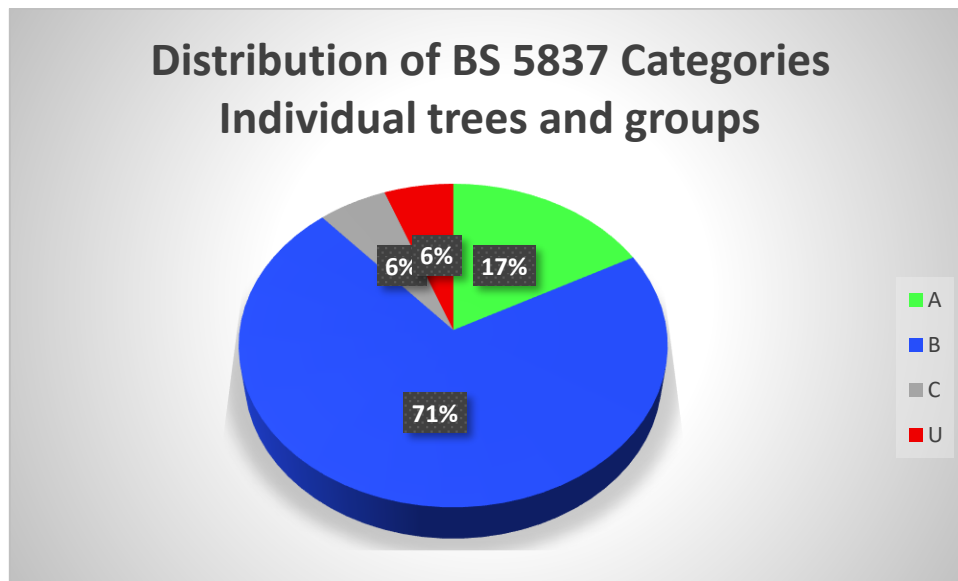

6.0 Conclusions

- 6.1 The TCP (Appendix 4) outlines the limitations imposed on the site by the tree canopy and their Root Protection Areas (RPAs). This information should guide the design process for the proposed development and must be accessible to all disciplines engaged in the design of the school. The canopies and root protection zones of the boundary trees and groups should influence the development design to favour their retention.

7.0 Recommendations

- 7.1 It is advisable to seek early arboricultural guidance to ensure that the design layout effectively incorporates the retention of more prominent trees (Cat A, Cat B) in the initial design layout. This report should be made available to all disciplines involved in the scheme, in particular drainage engineers and landscape architects to avoid works within the RPA.
- 7.2 Once the design is finalised an Arboricultural Impact Assessment should be undertaken to assess all impacts to the trees on site. Full details should be provided including drainage plans, proposed surfacing, final levels, positions of proposed structures and any landscaping arrangements. In addition to the AIA and Arboricultural Method Statement (AMS) should be undertaken detailing the method of works and other protection methods. All site operatives should be made aware of the protection details in the AMS and should remain in place throughout construction.

Appendix 1

Survey Key

Tree No. Sequential reference number e.g., T1, T2 for individual trees, where trees are determined to be a group they will be denoted as follows G1, G2 and W1, W2 for woodlands.

Species: Recorded and listed by both common name and scientific name

Stem: Principal above ground structural component(s) of a tree that supports its branches.

Height: Provides indication of the height of the tree and is measured in meters from ground level to the upper canopy edge and is recorded up to the nearest half meter for heights up to 10 meters and the nearest meter for heights over 10 meters.

Stem diameter: Measured at a height of 1.5 meters from ground level using a diameter tape and recorded in millimetres. Where the stem cannot be measured at 1.5 meters due to irregular swellings on the stem or low branching then the position of measurement will be taken in accordance with the specification in Annex C of BS 5837:2012

Crown spread: Measured at the four cardinal points of a compass (north, south, east, and west) from the centre of the stem and rounded up to the nearest meter in order to provide an accurate representation of the crown spread in order to show above ground constraints.

Crown height: Measured distance between the lowest points of the crown from ground level.

Life stage: A method of age estimation e.g. young - the first one third of the estimated life expectancy, middle mature- the second third of the estimated life expectancy, mature- The last third of the estimated life expectancy, over mature- trees showing obvious signs of senescence

First significant branch (FSB): The direction of growth of the first significant branch from the point of attachment.

Comments: A brief evaluation and description of the tree in order to inform on significant defects or characteristics relating to tree form. Where comments are not present it should be assumed that no relevant features were exhibited.

Recommendations: Arboricultural recommendations based on the current land use only and are provided where action is required in order to aid in the long-term management of the tree or for reasons of site safety.

Survey restrictions: It may be necessary on occasion to estimate tree dimensions where access is not available or where structure(s) or vegetation is precluding the visual assessment. Where dimensions are estimated it will clearly be marked in the tree survey schedule and be suffixed with #.

Root protection area (RPA) Layout design tool indicating the minimum area around a tree deemed to contain sufficient roots and rooting volume to maintain the trees viability. All stem diameters are calculated in line with the guidance given in BS 5837:2012 Annex D

Tree categorisation: a method of apportioning a value (non-fiscal) to trees in order to identify the quality and value of existing tree stocks, allowing for informed decisions to be made regarding which trees are to be retained or removed dependant on development occurring. Category U-Those in such a condition that cannot realistically be retained as living trees in the context of the current land use for longer than 10 years. Category A-Trees of a high quality with an estimated life expectancy of at least forty years. Category B-Trees of a moderate quality with an estimated remaining life expectancy of at least 20 years. Category C-Trees of a low quality with an estimated remaining life expectancy of at least 10 years.

Please refer to Table 1 Cascade chart for tree quality assessment, including subcategories, reference BS 5837:2012

Estimated remaining contribution: estimated remaining life expectancy e.g. <10, 10+, 20+, 40+

Statutory wildlife obligations: The Wildlife and Countryside Act 1981

The Wildlife and Countryside Act 1981 as amended, the Countryside and rights of Way Act 2000 and the Conservation (Natural Habitats) Regulations 1994.

These regulations protect all wild birds and make it an offence to intentionally or recklessly disturb any wild bird listed on Schedule 1 while it is nest building, or at a nest containing eggs or young, or disturb the dependent young of such a bird.

Furthermore, the Act makes it an offence (with exception to species listed in Schedule 2) to intentionally:

- kill, injure, or take any wild bird,
- take, damage or destroy the nest of any wild bird while that nest is in use or being built (also [take, damage or destroy the nest of a wild bird included in Schedule ZA1] under the Natural Environment and Rural Communities Act 2006), or
- take or destroy an egg of any wild bird

Bats are protected under Schedule 2 of the Conservation (Natural Habitats) Regulations 1994 making it an offence to damage or destroy a roost site even if the roost is not occupied at the time. The potential fines for each offence is £5000 and if more than one bat is involved in the incident then the fine can be extended to £5000 per bat. A prison sentence can be issued with offenders serving up to six months in prison.

Appendix 2

Table 1 cascade chart

Category and definition	Criteria (including subcategories where appropriate)		Identification on plan
Trees unsuitable for retention (see Note)			
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	• Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) • Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline • Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality NOTE Category U trees can have existing or potential conservation value which it might be desirable to preserve; see 4.5.7		
	1 Mainly arboricultural qualities	2 Mainly landscape qualities	3 Mainly cultural values, including conservation
Trees to be considered for retention			
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation or other cultural value
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150 mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits	Trees with no material conservation or other cultural value


© The British Standards Institution 2012

Appendix 3 Survey schedule

Tree No.	latin name	Life Stage	Diameter(mm)	Stem Count	Height(m) / Crown Height (m)	North(m)	South(m)	East(m)	West(m)	Category	Estimated Remaining Life Expectancy (yrs)	Pick Comments	Comments	Recommendations	RPR(m)	RPA(m)
T1	Aesculus hippocastanum (Horse Chestnut)	EM	490	1	15(0)	7	3	5	6	B1	40+		Tree adjacent to a hardcore access track located on the eastern aspect at 2m from the base, Ivy clad main stem, canopy weighted to the north due to group pressure, wooden fence brace affixed to the main stem on the western aspect of the main stem.		5.88	108.63
T2	Fraxinus excelsior (Ash)	M	630	1	18(0.5)	6	8	7	9	B1	40+		Tree adjacent to a hardcore access track located on the eastern aspect at 2m from the base, wooden fence brace affixed to the main stem on the western aspect of the main stem. Included main union present at 1.8m above ground level, longitudinal cavity located on the northern stem approximately 2m long, 5cm deep,10cm wide,8m above ground level, historic pruning evident on the southern aspect of the canopy caused from utility clearance works.		7.56	179.58
T3	Aesculus hippocastanum (Horse Chestnut)	M	570	1	16(1)	9	4	7	5	B1	40+		Tree adjacent to a hardcore access track located on the western aspect at 2m from the base, the main stem trifurcates at 2m above ground level, partially occluded pruning wounds located on the western aspect.		6.84	147
T4	Tilia X europaea (Common Lime)	EM	490	1	16(0)	3	5	5	5	B1	40+		Tree adjacent to a hardcore access track located on the western aspect at 2m from the base, Included main union at 2m above ground level, historic pruning evident on the upper canopy caused from utility clearance works.		5.88	108.63
T5	Aesculus hippocastanum (Horse Chestnut)	EM	520	1	16(0.5)	7	5	7	8	B1	40+		Tree adjacent to a hardcore access track located on the eastern aspect at 2m from the base, wooden fence brace affixed to the main stem on the western aspect of the main stem, partially occluded pruning wounds located on the eastern aspect.		6.24	122.34
T6	Sorbus aucuparia (Rowan)	SM	170	1	2(9)	1	2	2	2	C1	20+		Suppressed tree adjacent to a hardcore access track located on the eastern aspect at 2m from the base, wooden fence brace affixed to the main stem on the western aspect of the main stem.		2.04	13.08
T7	Fraxinus excelsior (Ash)	EM	490	1	16(1.5)	6	5	5	8	B1	20+		Tree adjacent to a hardcore access track located on the eastern aspect at 2m from the base, wooden fence brace affixed to the main stem on the western aspect of the main stem, moderate deadwood present throughout the canopy, early Ash die back present.		5.88	108.63
T8	Acer pseudoplatanus (Sycamore)	M	440	1	16(1.5)	4	5	3	6	B1	40+		Partially ivy clad tree adjacent to a hardcore access track located on the eastern aspect at 2m from the base, large historic pruning wound with epicormic growth is located on the north eastern aspect of the main stem at 2m above ground level.		5.28	87.59
T9	Acer pseudoplatanus (Sycamore)	EM	490	1	16(5)	6	6	6	6	B1	40+		Tree adjacent to a hardcore access track located on the western aspect at 2m from the base, compression fork at 2.5m above ground level in the main union, historical pruning works evident on the northern aspect caused from utility clearance works.		5.88	108.63
T10	Acer platanoides (Norway Maple)	EM	360	1	15(5)	4	5	6	6	B1	40+		Tree located adjacent to a hardcore access track located on the western aspect at 2m from the base, partially occluded longitudinal scar 1.5m long present on the north eastern aspect of the main stem.		4.32	58.64
T11	Aesculus hippocastanum (Horse Chestnut)	EM	430	1	13(1)	4	5	5	4	B1	40+		Tree adjacent to a hardcore access track located on the western aspect at 2m from the base, previous limb failure evident in the eastern aspect of the canopy, epicormic growth present on the main stem.		5.16	83.66
T12	Fraxinus excelsior (Ash)	EM	480	1	14(2)	5	6	4	7	B1	40+		Ivy clad tree adjacent to a hardcore access track located on the eastern aspect at 2m from the base, wooden fence brace affixed to the main stem on the western aspect of the main stem, moderate deadwood present throughout the canopy, early Ash die back present.		5.76	104.24
T13	Aesculus hippocastanum (Horse Chestnut)	EM	610	1	16(1.5)	7	5	5	7	B1	40+		Tree adjacent to a hardcore access track located on the eastern aspect at 2m from the base, wooden fence brace affixed to the main stem on the western aspect of the main stem, partially occluded pruning wounds located on the eastern aspect.		7.32	168.36
T14	Quercus rubra (Red Oak)	EM	620	1	16(1)	6	5	5	8	B1	40+		Tree adjacent to a hardcore access track located on the eastern aspect at 1m from the base, wooden fence brace affixed to the main stem on the western aspect of the main stem, partially occluded large pruning wound located on the eastern aspect of the main stem at 2.5m above ground level.		7.44	173.92
T15	Acer platanoides (Norway Maple)	EM	500	1	16(2)	5	6	6	5	B1	40+		Tree adjacent to a hardcore access track located on the western aspect at 2m from the base, main stem bifurcates at 2m above ground level, minor deadwood present throughout the canopy.		6	113.11
T16	Aesculus hippocastanum (Horse Chestnut)	EM	450	1	13(4)	2	4	6	3	U	<10		Standing dead tree.		5.4	91.62

Tree No.	latin name	Life Stage	Diameter(mm)	Stem Count	Height(m) / Crown Height (m)	North(m)	South(m)	East(m)	West(m)	Category	Estimated Remaining Life Expectancy (yrs)	Pick Comments	Comments	Recommendations	RPR(m)	RPA(m)
T17	Aesculus hippocastanum (Horse Chestnut)	EM	380	1	15(1)	4	4	5	6	B1	40+		Tree adjacent to a hardcore access track located on the eastern aspect at 2m from the base, wooden fence brace affixed to the main stem on the western aspect of the main stem. Compression fork present at main union, poor partially occluded pruning wound on the eastern aspect at 2m above ground level.		4.56	65.33
T18	Tilia X europaea (Common Lime)	EM	460	1	13(1)	4	5	1	5	B1	40+		Tree adjacent to a hardcore access track located on the eastern aspect at 0.5m from the base, partially occluded pruning wounds located on the eastern aspect of the main stem with epicormic growth present.		5.52	95.74
T19	Acer platanoides (Norway Maple)	EM	550	1	15(2)	6	4	7	6	B1	40+		Tree adjacent to a hardcore access track located on the western aspect at 2m from the base, minor deadwood present throughout the canopy, main stem trifurcates at 1.8m above ground level, partially occluded poor pruning wounds present on the western aspect.		6.6	136.87
T20	Aesculus hippocastanum (Horse Chestnut)	EM	380	1	14(1)	4	5	6	4	B1	40+		Tree adjacent to a hardcore access track located on the western aspect at 2m from the base, partially occluded pruning wound located on the western aspect of the main stem at 1.5m above ground level, epicormic growth present.		4.56	65.33
T21	Platanus X hispanica (London Plane)	EM	560	1	16(1.5)	5	7	6	6	B1	40+		Tree adjacent to a hardcore access track located on the eastern aspect at 3m from the base, basal cavity 1.5m long 25cm deep,30cm wide located on the southern aspect of the main stem, partially occluded poor pruning wound located on the northern aspect of the main stem at 3m above ground level, cavity located on the western aspect of the main stem approximately 30cm long, depth undetermined, occluded wood present.		6.72	141.89
T22	Aesculus hippocastanum (Horse Chestnut)	EM	460	1	13(1)	3	4	6	4	U	<10		Standing dead tree.		5.52	95.74
T23	Quercus rubra (Red Oak)	EM	370	1	15(0)	6	7	6	7	B1	40+		Tree adjacent to a hardcore access track located on the western aspect at 3m from the base, minor deadwood present throughout the canopy, minor snapped hanging branch located at 9m above ground level on the western aspect, partially occluded pruning wounds located on the western aspect of the main stem.		4.44	61.94
T24	Aesculus hippocastanum (Horse Chestnut)	EM	490	1	14(1)	6	6	6	6	B1	20+		Tree in a grassed area, white rot decay present on the southern aspect of the main stem from ground level up to 1.5m.		5.88	108.63
H1	Fagus sylvatica (Beech)	SM	70	1	3(0)	1	1	1	1	C2	40+		Unmaintained hedge line.		0.84	2.22
T25	Fagus sylvatica (Beech)	M	1430	1	18(1)	9	10	10	8	A1	40+		Mature tree on woodland edge, ivy clad main stem.		15	706.95
T26	Aesculus hippocastanum (Horse Chestnut)	M	740	1	14(1.5)	7	3	5	4	B1	20+		Mature tree on woodland edge, ivy clad main stem, historical limb failure evident in the upper canopy.		8.88	247.76
T27	Fagus sylvatica (Beech)	M	1470	1	19(3)	8	8	9	9	A1	40+		Mature tree on woodland edge, partially ivy clad main stem, multiple previous limb failures evident.		15	706.95
T28	Acer pseudoplatanus (Sycamore)	M	640	1	16(1)	8	6	6	8	A1	40+		Mature tree on woodland edge, partially ivy clad main stem with basal growth present.		7.68	185.32
G1	Acer pseudoplatanus (Sycamore)	EM	360	1	15(1)	4	4	4	4	B2	40+		Group on woodland edge, Dbh range 310mm-360mm.		4.32	58.64
T29	Fagus sylvatica (Beech)	M	1450	1	17(4)	10	10	10	10	A1	40+		Mature tree on woodland edge, historical limb failure evident on the southern aspect of the lower canopy, measurements estimated due to no access.		15	706.95
W1	Acer pseudoplatanus (Sycamore),Quercus robur (Common Oak),Fagus sylvatica (Beech)	EM	550	1	17(3)	5	5	5	5	A2	40+		Mixed species woodland Dbh range 300mm-800mm.		6.6	136.87
W2	Acer pseudoplatanus (Sycamore),Fagus sylvatica (Beech),Tilia X europaea (Common Lime)	M	1350	1	17(1)	8	8	8	8	A2	40+		Mixed species woodland Dbh range 250mm-1350mm		15	706.95
G2	Acer pseudoplatanus (Sycamore),Quercus robur (Common Oak),Tilia X europaea (Common Lime)	EM	450	1	15(1)	4	4	4	4	B2	40+		Mixed species group adjacent to over head high voltage power cables, Dbh range 150mm-450mm.		5.4	91.62
G3	Acer pseudoplatanus (Sycamore),Acer campestre (Field Maple),Crataegus monogyna (Hawthorn),Fraxinus excelsior (Ash),Betula pendula (Silver Birch),Fagus sylvatica (Beech)	SM	400	1	14(0)	4	4	4	4	B2	40+		Mixed species group adjacent to the motorway to the north and a hardcore track to the south, Dbh range 100mm-400mm.		4.8	72.39

Appendix 4 Tree Constraints Plan

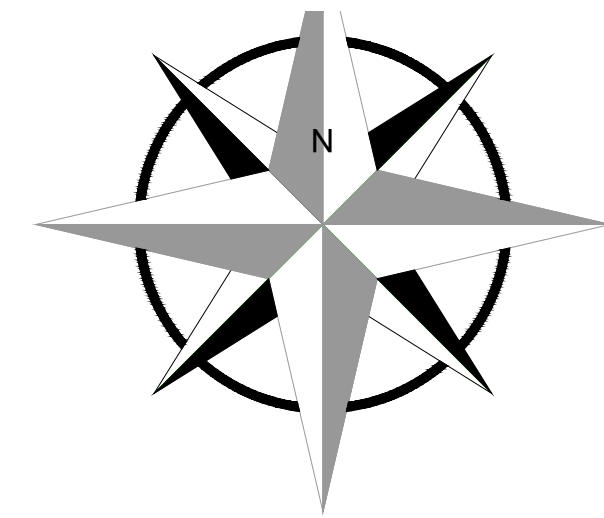

TREE CONSTRAINTS PLAN

Retention value key

(RETENTION VALUE A)


(RETENTION VALUE B)

(RETENTION VALUE C)

Trees to be removed
(RETENTION VALUE U)

Root Protection Areas (RPA)

Root Protection Areas (RPA's) have been identified and are based on BS5837:2012. RPA's have been shown as a red polyline.

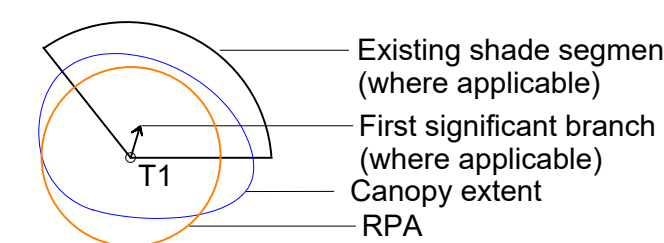

WARNING This drawing will not be read in black and white

AMENITYTREE

The Annexe, Willow Hill Cottage,
School Lane, Burwardsley, Chester.
CH3 9NX
Tel. 01829 770075

Client:
Starship Hub

Project:
Halswood Farm, Fox's Bank Lane, Whiston, Widnes, Prescot L35 3SU
12449

Detail:
TREE CONSTRAINTS PLAN - Overview

Drawn By:	Date:	Scale:
PS	07/07/2025	1:500 - A0
Org No:	Revision:	
TR-01-Overview Sheet	V1	