



WE KNOW SERVICES

ARBORICULTURAL METHOD STATEMENT

Site

Former Education Building, Huyton Hey Road

Client

Knowsley Council

Report Date

September 2023

Version

First Issue

We Know Services
Court Hey Park, Roby Road, Huyton L16 3NA
E: info@weknowservices.co.uk

Ref: 23/00013/AMS
Author: Jonathan Henderson
Qualifications: B.Sc Hons, TechArborA

Arboricultural Method Statement – Former Education Building, Huyton Hey Road



An image showing T4 (R), T5 and T6 (L).

Quality Assurance

The information which the author has prepared and provided is true and has been prepared and provided in accordance with the Arboricultural Association's Code of Ethics and Conduct. We confirm that the opinions expressed within this report are true and represents the author's professional opinions.

Disclaimer

The report has been prepared for the sole use of the client, showing reasonable skill and care, for the intended purposes as stated in the agreement under which this work was completed. The report may not be relied upon by any other party without the express agreement of the client and the author. No other warranty, expressed or implied, is made as to the professional advice included in this report. Where any data supplied by the client or from other sources have been used, it has been assumed that the information is correct. No responsibility can be accepted by the author for inaccuracies in the data supplied by any other party. The conclusions and recommendations in this report are based on the assumption that all relevant information has been supplied by those bodies from whom it was requested. No part of this report may be copied or duplicated without the express permission of the author and the party for whom it was prepared. Where field investigations have been carried out, these have been restricted to a level of detail required to achieve the stated objectives of the work.

Table of Contents

1. Introduction 1

2. The Importance of Protecting Tree Roots from Development Related Activities 1

3. Method Statement 2

 3.1 Tree Works 2

 3.2 Tree Protective Fencing..... 2

 3.3 Additional Precautions When Working in Proximity of Trees..... 3

Appendix 1.0 Tree Protection Plan..... 4

Appendix 2.0 Tree Fencing Specification 6

1. Introduction

Resulting from the Arboricultural Impact Assessment (ref: 23/00013/AIA), an Arboricultural Method statement has been recommended to ensure good working practices when working in proximity to trees to implement the proposed development.

The need for this method statement is a result of the client's proposals as outlined in the Arboricultural Impact Assessment.

The following information outlines the need for an Arboricultural Method Statement.

2. The Importance of Protecting Tree Roots from Development Related Activities

Most of the root system of a tree is in the top 600mm of the soil, extending radically for distances frequently more than the trees height. Beyond the main structural roots, the root system rapidly sub-divides into smaller diameter roots until a mass of fine roots develops.

The main structural roots develop in response of the need for the tree to have physical stability. Beyond these major roots, root growth and development are influenced by the availability of water and nutrients.

Unless conditions are uniform around the tree, the location and extent of the root system is typically irregular and difficult to predict. Typically, it will not reflect the symmetry seen in the branch system.

The parts of the root system, which are active in water and nutrient uptake are very fine, typically less than 0.5mm diameter. They are short lived and develop in response to the needs of the tree, with the majority dying each winter.

It is essential that conditions in the soil remain conducive to the healthy growth of these fine roots so that the water and nutrients necessary for healthy tree growth can be absorbed.

All parts of the root system, but especially the fine roots, are vulnerable to damage. Once they are damaged, water and nutrient uptake will be restricted until new roots have regenerated. Vigorous young trees will be capable of rapid regeneration, but over mature trees will respond slowly, if at all.

To live and grow, roots need oxygen from the soil. Respiration by the roots and other soil organisms depletes this oxygen and increases carbon dioxide levels in the soil; a correct balance of these gases is normally maintained by diffusion between the soil and the atmosphere. Anything, which disturbs this balance, will affect the condition of the root system.

The factors that most commonly affect this diffusion adversely, and therefore damage roots, are the following: -

- A. Compaction of the ground, which reduces the space between soil particles. This is particularly important on clay soils. A single passage by heavy equipment on clay soils or storage of heavy materials can cause significant damage to the structure of the soil.
- B. Altered soil levels, even for a few weeks.
- C. Covering the root area with impervious surfaces.
- D. A rise in the level of the water table. Roots can tolerate submersion for short periods. But a permanent rise will deplete the soil of oxygen.
- E. Excavations in the rooting area can sever roots. As most roots are in the surface 600mm, even shallow excavations can cause damage.
- F. Excavations for foundations, landscaping, service trenches or soil stripping which sever or damage the roots may impair the stability of the tree and make it dangerous.

Serious damage is often caused during preliminary site works by stripping the topsoil. For this reason, such works should be avoided until protective fencing has been erected.

3. Method Statement

3.1 Tree Works

Before any form of development commences on the site the following works should be undertaken: -

Tree No.	Proposed Works
T1, T2, T3, T4, T5, T6	30% Crown Reduction
T4, T5, T6	Sever ivy from base to 2m

3.2 Tree Protective Fencing

All fencing used on the site should fully comply with BS 5837:2012 (Trees in Relation to Construction – Recommendations), refer to Appendix 2.0 for specifications.

The fencing should be strong and suitable for local conditions. It should also consider the degree of construction activity on the site.

The fencing should be at least 2.3m in height and should be erected with both a vertical and horizontal scaffolding framework capable of withstanding impact, with vertical tubes

spaced at a maximum of 3 m. This should support either weldmesh panels which should be securely fixed with wire or scaffold clamps.

Notices should also be erected on the fencing stating 'Protected Area - No operations within fenced area'.

The positioning of the protective fencing is also very important and should be erected in the proposed location identified in Appendix 1.0. Once the fence has been erected it should never be crossed and particular care should be taken to store any materials or soil within the protected area.


Where it is demonstrated that there is a presence of underground services, an alternative arrangement is acceptable using boots to support the vertical sections of the fence and a stabilizer strut mounted on a block tray.

3.3 Additional Precautions When Working in Proximity of Trees

The following precautions should always be adhered to during construction:

- Oil, bitumen, cement, or other material likely to cause damage to the tree will not be stacked or discharged within 10m of the trees stem or within the protective area. Also, materials in general will not be stacked or discharged within the exclusion zone.
- Concrete mixing and washing will not be carried out within 10m of any retained trees.
- Fires will not be lit beneath the foliage or in a position where the flames could extend to within 5m of the foliage, branches, or trunk. If the fire is large, then this may necessitate a distance of at least 20m.
- Trees that are to be retained will not be used as anchorage for equipment.
- Notice boards, telephone cables, or other services will not be attached to any part of the retained tree.
- Care should be taken when using cranes or other equipment near the canopy of the retained trees. Also, any trees to be felled in proximity to the retained trees should be done so with particular care.

Appendix I.0 Tree Protection Plan

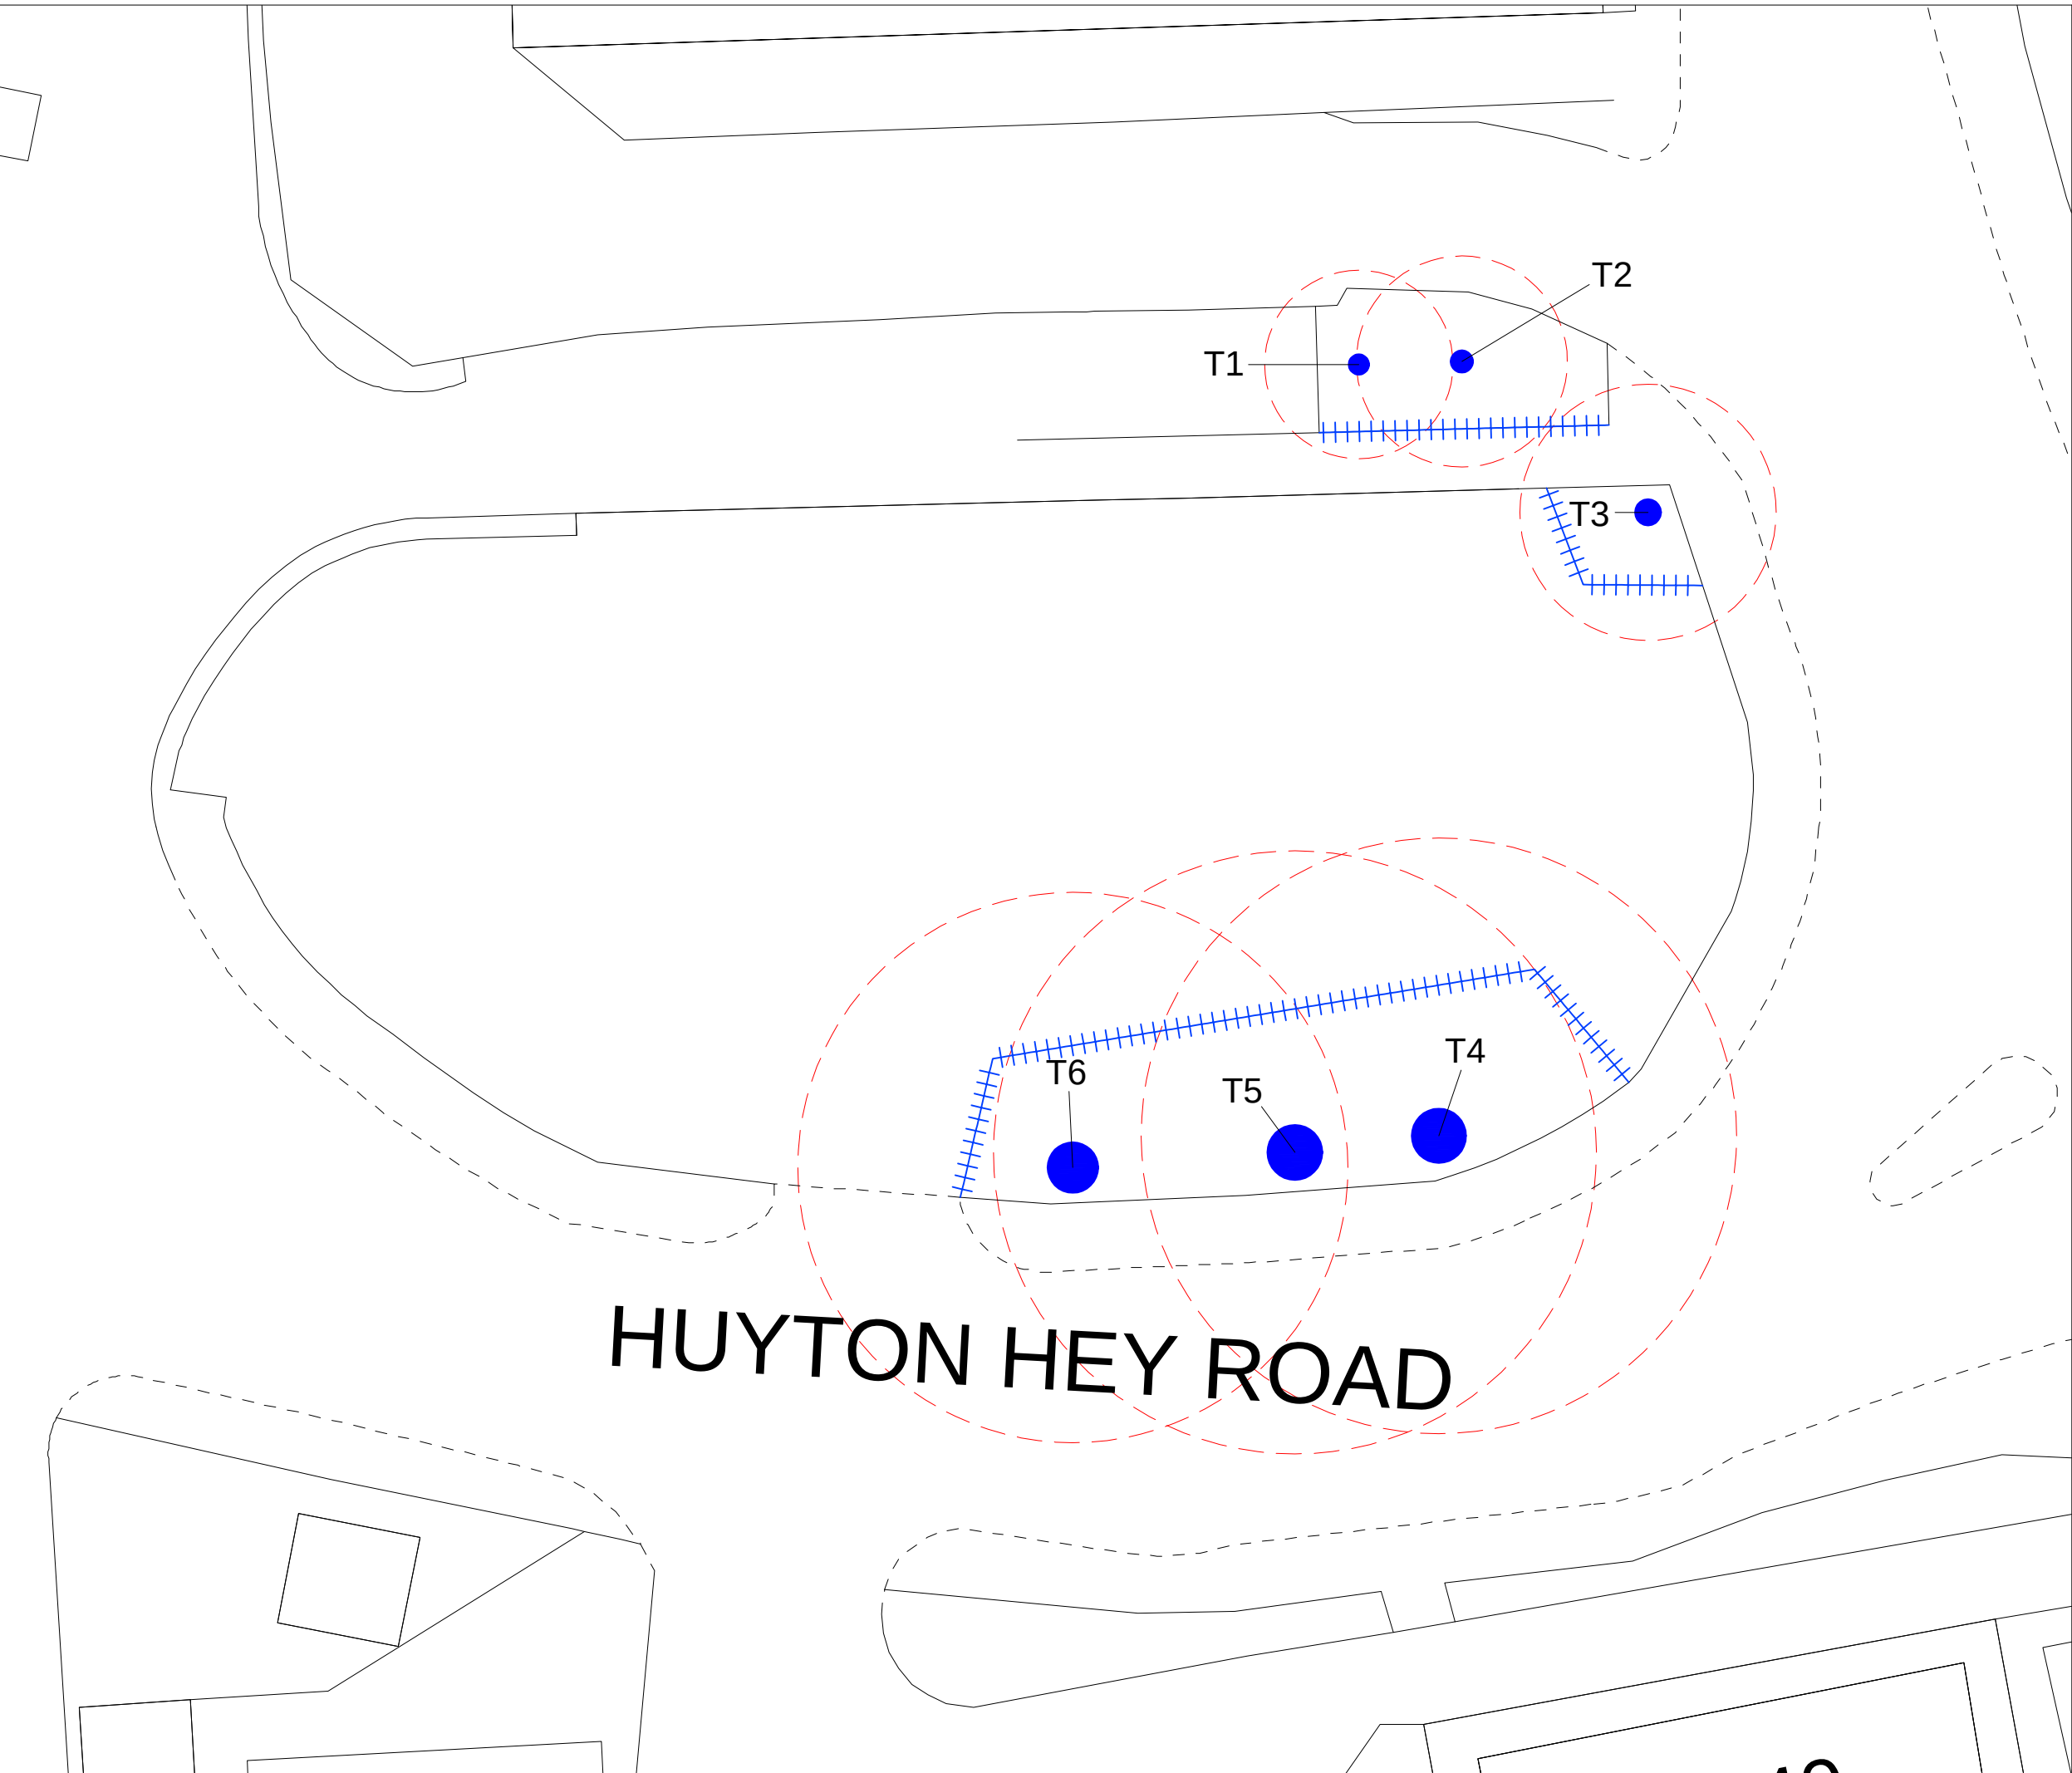

-  Retained Trees
-  Trees to be Removed
-  Root protection area
-  Tree protection fencing



Court Hey Park
Roby Road
Huyton
L16 3NA

Email: info@weknowservices.co.uk



Client:
Knowsley Council

Site Address:
Former Education Building
Huyton Hey Road
Huyton
L36 5YH

Drawing Title:	Drawing No:	
Tree Protection Plan	23/00013/TPP	
Date:	Scale:	Drawn by:
19/09/2023	1:100@A3	JH

Note: Dimensions are not to be scaled from this drawing.
All written measurements are to be checked on site by the contractor. Copyright WeKnow Services.
Note: All rights described in Chapter IV of the Copyright Design & Patents Act 1988 have generally been asserted.

Appendix 2.0 Tree Fencing Specification

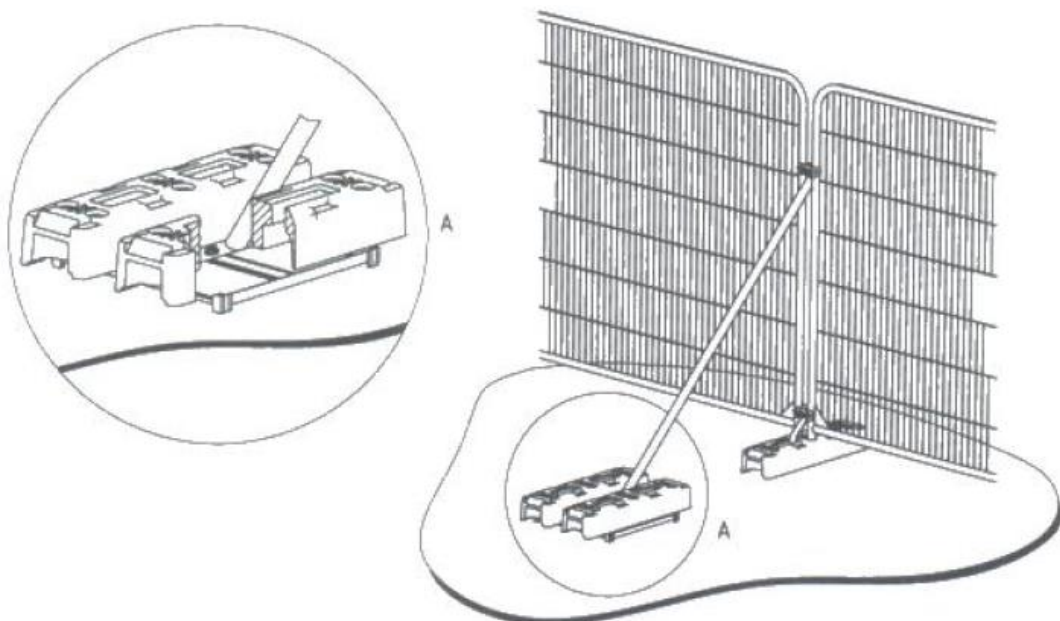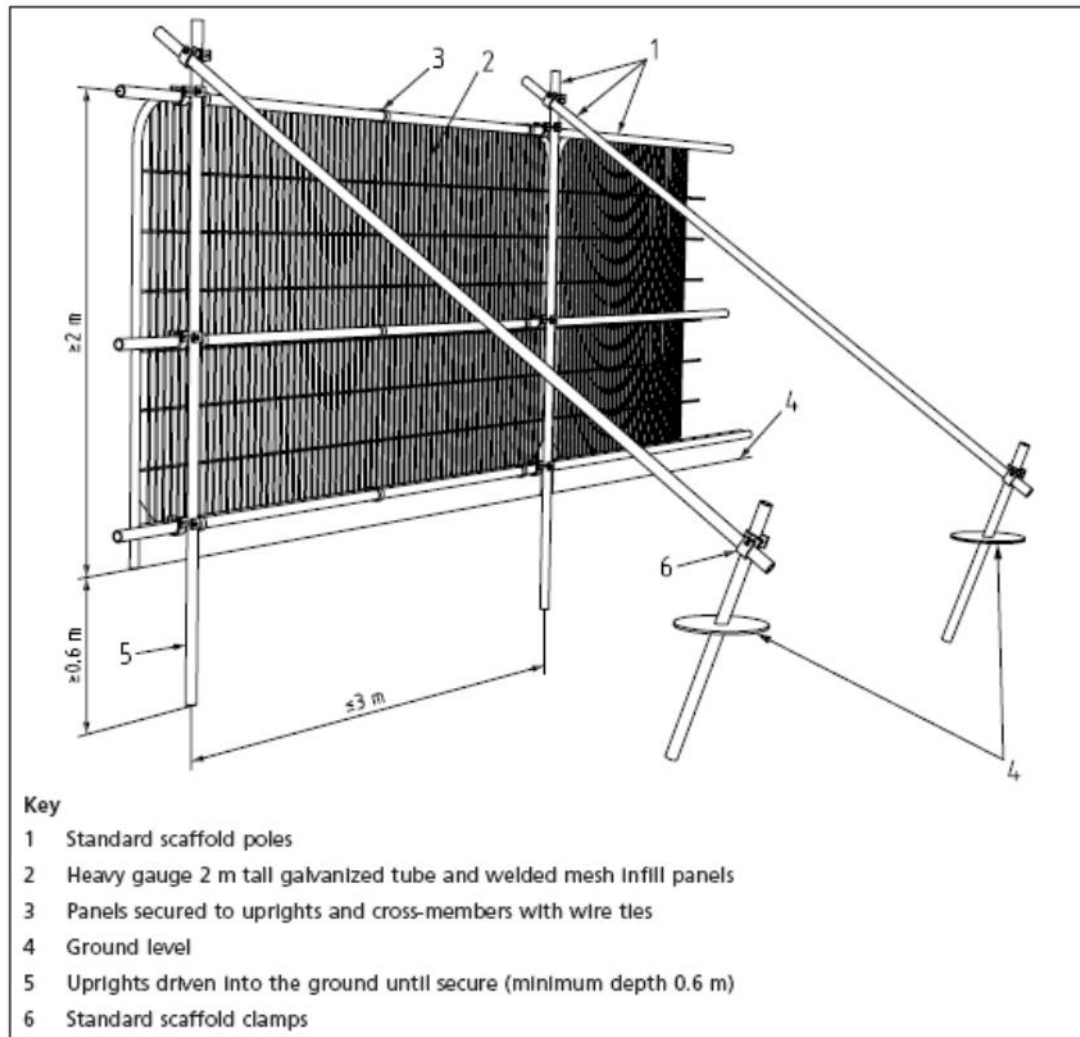

b) Stabilizer strut mounted on block tray